




# BLM Series "U-Channel" Linear Motor

## HARDWARE MANUAL

Revision 3.00

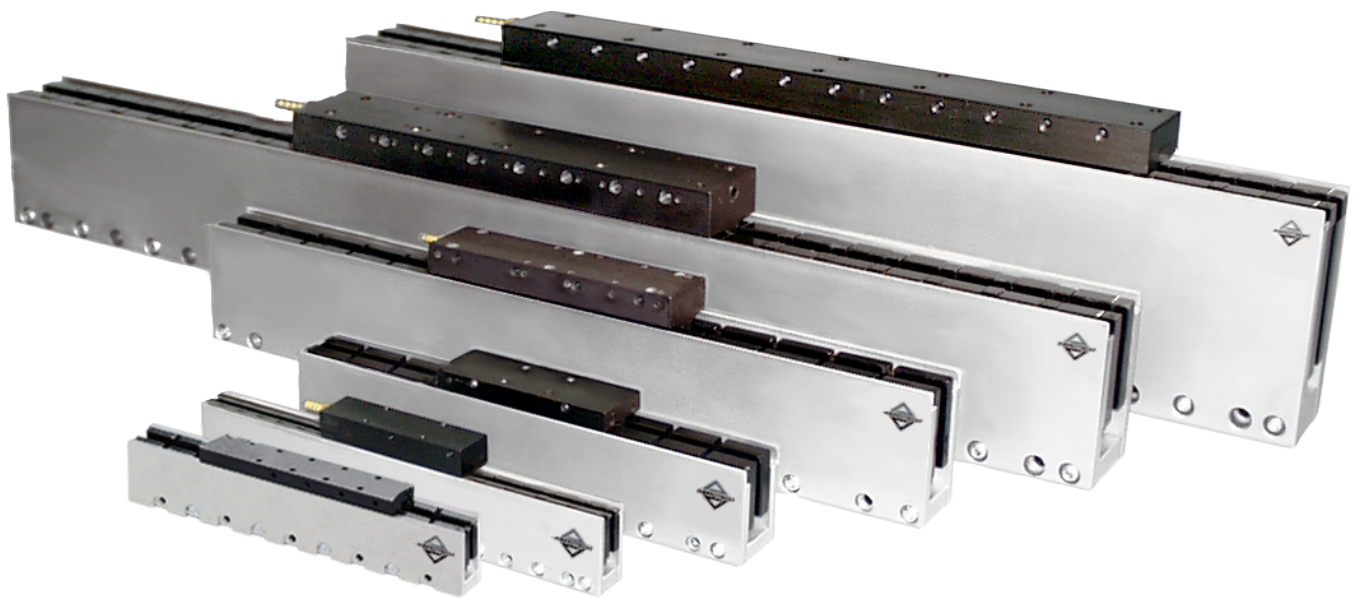

## GLOBAL TECHNICAL SUPPORT

Go to the [Global Technical Support Portal](#) for information and support about your Aerotech, Inc. products. The website supplies software, product manuals, Help files, training schedules, and PC-to-PC remote technical support. If necessary, you can complete Product Return (RMA) forms and get information about repairs and spare or replacement parts. To get help immediately, contact a service office or your sales representative. Include your customer order number in your email or have it available before you call.

This manual contains proprietary information and may not be reproduced, disclosed, or used in whole or in part without the express written permission of Aerotech, Inc. Product names mentioned herein are used for identification purposes only and may be trademarks of their respective companies.

Copyright © 1995-2023, Aerotech, Inc., All rights reserved.



## Table of Contents

<b>BLM Series "U-Channel" Linear Motor</b> .....	<b>1</b>
Table of Contents .....	3
List of Figures .....	4
List of Tables .....	5
EU Declaration of Conformity .....	7
UKCA Declaration of Conformity .....	8
Safety Procedures and Warnings .....	9
Installation and Operation .....	10
Electrical Warnings .....	11
Motor-Related Warnings .....	12
Pinch Points .....	13
Magnetic Hazards .....	14
Handling and Storage .....	15
<b>Chapter 1: Overview</b> .....	<b>17</b>
1.1. Motor Specifications .....	23
1.2. Dimensions .....	34
1.3. Environmental Specifications .....	40
1.4. Air Requirements .....	41
1.5. Vacuum Operation .....	42
<b>Chapter 2: Assembly and Installation</b> .....	<b>43</b>
2.1. Bearing System .....	44
2.2. Position Transducer Resolution .....	44
2.3. Cable Management .....	44
2.4. Mechanical Arrangement of the Magnet Track .....	45
2.5. Track Stacking .....	45
2.6. Straightness and Flatness Tolerance .....	46
2.6.1. BLMSC Tolerances .....	46
2.6.2. BLMUC Tolerances .....	47
2.6.3. BLMC Tolerances .....	48
2.6.4. BLM Tolerances .....	49
2.6.5. BLMH Tolerances .....	50
2.6.6. BLMX Tolerances .....	51
2.7. External Motor Wiring .....	52
2.7.1. Motor Power Conductors .....	53
2.7.2. Protective Ground .....	53
2.7.3. Over-Current Protection .....	53
2.7.4. Hall-Effect Device and Thermistor Wiring .....	54
2.7.5. Wiring Guidelines .....	54
2.7.6. Thermal Protective Device .....	55
2.8. Hall-Effect Operation and Motor Phasing .....	57
2.9. Motor Heating .....	58
<b>Chapter 3: Maintenance</b> .....	<b>59</b>
<b>Appendix A: Warranty and Field Service</b> .....	<b>61</b>
<b>Appendix B: Revision History</b> .....	<b>63</b>
<b>Index</b> .....	<b>65</b>

## List of Figures

Figure 1-1: BLMSC Model Dimensions .....	34
Figure 1-2: BLMUC Model Dimensions .....	35
Figure 1-3: BLMC Model Dimensions .....	36
Figure 1-4: BLM Model Dimensions .....	37
Figure 1-5: BLMH Model Dimensions .....	38
Figure 1-6: BLMX Model Dimensions .....	39
Figure 2-1: Motor Assembled in a Linear Stage .....	43
Figure 2-2: Linear Motor Mounting Configurations (end view) .....	45
Figure 2-3: Stacking Tracks .....	45
Figure 2-4: BLMSC Straightness and Flatness Tolerances .....	46
Figure 2-5: BLMUC Straightness and Flatness Tolerances .....	47
Figure 2-6: BLMC Straightness and Flatness Tolerances .....	48
Figure 2-7: BLM Straightness and Flatness Tolerances .....	49
Figure 2-8: BLMH Straightness and Flatness Tolerances .....	50
Figure 2-9: BLMX Straightness and Flatness Tolerances .....	51
Figure 2-10: Motor Wiring with Flying Leads .....	52
Figure 2-11: Thermal Sensor Resistance as a Function of Temperature .....	55
Figure 2-12: Typical Thermistor Interface Circuit .....	56
Figure 2-13: Linear Motor Phasing .....	57

## List of Tables

Table 1-1: BLMSC Options .....	17
Table 1-2: BLMUC Options .....	18
Table 1-3: BLMC Forcer Options .....	19
Table 1-4: BLM Options .....	20
Table 1-5: BLMH Options .....	21
Table 1-6: BLMX Options .....	22
Table 1-7: BLMSC Motor Specifications .....	23
Table 1-8: BLMUC Motor Specifications (P Magnet Track) .....	24
Table 1-9: BLMUC Motor Specifications (S Magnet Track) .....	25
Table 1-10: BLMC Motor Specifications (P Magnet Track) .....	26
Table 1-11: BLMC Motor Specifications (S Magnet Track) .....	27
Table 1-12: BLM Motor Specifications (P Magnet Track, BLM-142, BLM-203, BLM-264) .....	28
Table 1-13: BLM Motor Specifications (P Magnet Track, BLM-325, BLM-386) .....	29
Table 1-14: BLM Motor Specifications (S Magnet Track, BLM-142, BLM-203, BLM-264) .....	30
Table 1-15: BLM Motor Specifications (S Magnet Track, BLM-325, BLM-386) .....	31
Table 1-16: BLMH Motor Specifications .....	32
Table 1-17: BLMX Motor Specifications .....	33
Table 1-18: Environmental Specifications .....	40
Table 2-1: Bend Radius .....	44
Table 2-2: Cable Diameter and Wire Gauge .....	52

*This page intentionally left blank.*

## EU Declaration of Conformity

**Manufacturer** Aerotech, Inc.  
**Address** 101 Zeta Drive  
 Pittsburgh, PA 15238-2811  
 USA



Declares that the product:

**Product** BLMSC, BLMUC, BLMC, BLM, BLMH, BLMX Motors (excluding VAC6 versions)  
**Model/Types** All

To which this declaration relates, meets the essential health and safety requirements and is in conformity with the relevant EU Directives listed below:

2014/35/EU	Low Voltage Directive
EU 2015/863	Directive, Restricted Substances (RoHS 3)

Using the relevant section of the following EU Standards and other normative documents:

IEC 60034-1:2010	Rotating electrical machines
IEC 61010-1:2010	Safety requirements for electrical equipment for measurement, control, and laboratory use
NOTE:	Safe operation of the motor requires over speed and over current protection. This could be done by the connected controller / amplifier combination.

**Authorized Representative:**

/ Norbert Ludwig

Managing Director  
 Aerotech GmbH  
 Gustav-Weißkopf-Str. 18  
 90768 Fürth  
 Germany

**Engineer Verifying Compliance:**

/ Matt Maurer

Aerotech, Inc.  
 101 Zeta Drive  
 Pittsburgh, PA 15238-2811  
 9/12/2023

**Date**

## UKCA Declaration of Conformity

**Manufacturer** Aerotech, Inc.  
**Address** 101 Zeta Drive  
 Pittsburgh, PA 15238-2811  
 USA



Declares that the product:

**Product** BLMSC, BLMUC, BLMC, BLM, BLMH, BLMX Motors (excluding VAC6 versions)  
**Model/Types** All

To which this declaration relates, meets the essential health and safety requirements and is in conformity with the relevant UK Legislation listed below:

Electrical Equipment (Safety) Regulations 2016  
 Hazardous Substances in Electrical and Electronic Equipment Regulations 2012

Using the relevant section of the following UK Designated Standards and other normative documents when installed in accordance with the installation instructions supplied by the manufacturer.

IEC 60034-1:2010	Rotating electrical machines
IEC 61010-1:2010	Safety requirements for electrical equipment for measurement, control, and laboratory use
NOTE:	Safe operation of the motor requires over speed and over current protection. This could be done by the connected controller / amplifier combination.

**Authorized Representative:**

/ Simon Smith

Managing Director  
 Aerotech Ltd  
 The Old Brick Kiln, Ramsdell, Tadley  
 Hampshire RG26 5PR  
 UK

**Engineer Verifying Compliance:**

/ Matt Maurer

Aerotech, Inc.  
 101 Zeta Drive  
 Pittsburgh, PA 15238-2811  
 9/12/2023

**Date**



## Safety Procedures and Warnings



**IMPORTANT:** This manual tells you how to carefully and correctly use and operate the motor.

- Read all parts of this manual before you install or operate the motor or before you do maintenance to your system.
- To prevent injury to you and damage to the equipment, obey the precautions in this manual.
- All specifications and illustrations are for reference only and were complete and accurate as of the release of this manual. To find the newest information about this product, refer to [www.aerotech.com](http://www.aerotech.com).

If you do not understand the information in this manual, contact Aerotech Global Technical Support.



**IMPORTANT:** This product has been designed for light industrial manufacturing or laboratory environments. If the product is used in a manner not specified by the manufacturer:

- The protection provided by the equipment could be impaired.
- The life expectancy of the product could be decreased.

Safety notes and symbols are placed throughout this manual to warn you of the potential risks at the moment of the safety note or if you fail to obey the safety note.



Shock/Electrocution Hazard



Pinch, Shear, or Crush Hazard



General/Conditional Awareness



Rotational Machinery Hazard



Hot Surface Hazard



Pinch/Entanglement Hazard



Magnetic Field Hazard



Trip Hazard



Heavy, Bulky Lifting Hazard



Appropriate Equipment Required



Pressure/Explosive Atmosphere Hazard



Electrostatic Discharge Hazard

A blue circle symbol is an action or tip that you should obey. Some examples include:



General tip



Read the manual/section



Wear personal protective equipment (PPE): Safety Glasses



If applicable, do not lift unassisted



Wear personal protective equipment (PPE): Gloves



Wear personal protective equipment (PPE): Hearing Protection

## Installation and Operation

To decrease the risk of damage to the equipment, you must obey the precautions that follow.



**IMPORTANT:** Aerotech motors are meant to be part of a drive package that consists of an amplifier and a controller. The motor relies on the drive package for fault protection. Do not use these motors in any other way.



### **DANGER: General Hazard Warning!**

This product can produce high forces and move at velocities that could cause injury. The user is responsible for its safe operation. The following general equation is provided to assist with risk assessments in regards to contact and pinch points:

$$Pressure_{Max} \left[ \frac{N}{mm^2} \right] = \frac{Force_{Peak} [N]}{Area_{Contact} [mm^2]}$$



### **WARNING: General Hazard Warning!**

- Only trained operators should operate this equipment.
- All service and maintenance must be done by approved personnel.
- Use this product only in environments and operating conditions that are approved in this manual.
- Never install or operate equipment that appears to be damaged.
- Make sure that the product is securely mounted before you operate it.
- Use care when you move the motor or you could negatively affect the performance of it.



### **WARNING: Trip Hazard!**

Route, house, and secure all cables, duct work, air, or water lines. Failure to do so could introduce trip hazards around the system that could result in physical injury or could damage the equipment.

## Electrical Warnings

To decrease the risk of electrical shock, injury, death, and damage to the equipment, obey the precautions that follow.

### **DANGER: Electrical Shock Hazard!**



- Motor phase voltage levels could be hazardous live.
- Personnel are protected from hazardous voltages unless electrical interconnections, protective bonding (safety ground), or motor enclosures are compromised.
- Do not connect or disconnect motor interconnections while connected to a live electrical power source.
- Before you set up or do maintenance, disconnect electrical power.
- Make sure that the motor frame is safety grounded with a conductor equal in size to the phase conductors.
- The drive must contain a properly-sized fuse, matched to the motor cable wire size.
- It is the responsibility of the End User/System Integrator to make sure that motors are properly connected and grounded per Engineering Standards and applicable safety requirements.
- It is the responsibility of the End User/System Integrator to configure the system drive or controller within the Aerotech motor electrical and mechanical specifications.

## Motor-Related Warnings

Aerotech motors are capable of producing high forces and velocities. Obey all warnings and all applicable codes and standards when you use or operate a stage or system that incorporates Aerotech motors.

### **DANGER: Mechanical Hazard!**

Personnel must be made aware of the mechanical hazards during set up or when you do service to the motor.



- When the system is not electrically energized (disabled), linear motors can still allow a stage carriage to move freely. This can create mechanical hazards such as pinch or crush points.
- Unintentional manual movement into the stage "end-of-travel" stops, could damage the stage or undo precision alignments.
- Motor movement could create pinch points, entanglement hazards, or rotational mechanical hazards.
- Uncouple or otherwise prevent motion of motor-coupled machinery when you do service to the equipment.

### **DANGER: Hot Surface Hazard!**



- The motor frame temperature could exceed 70°C in some applications.
- Do not touch the motor frame while it is in operation.
- Wait until the motor has cooled before you touch it.

### **DANGER: Risk of Explosive Atmosphere!**



- Standard Aerotech motors are not rated for applications with explosive atmospheres such as airborne dust or combustible vapors.
- Do not operate motors outside of Aerotech environmental specifications.

### **DANGER: Magnetic Field Hazard!**



Aerotech motors contain magnets which can present a Magnetic Field Hazard.

- Do not disassemble a motor under any circumstances.
- Strong magnetic fields could interfere with external/internal medical devices.
- Strong magnetic fields could present mechanical hazards such as pinch points.

## Pinch Points


A pinch point is a mechanical hazard that can occur when there are exposed parts of the motor, stage, or system that can move. For example, the travel of a stage tabletop could expose the user to a pinch point between the tabletop and the stage housing. The images that follow will show you typical external and internal pinch point locations.

### **DANGER: Mechanical Hazard!**



- System travel can cause crush, shear, or pinch injuries.
- Only trained operators should operate this equipment.
- Do not put yourself in the travel path of machinery.
- Restrict access to all motor parts
  - when the system moves under power (during normal operation, for example).
  - when the system is moved manually (during the installation process or when you do maintenance, for example).
- Motors are capable of very high speeds and acceleration rates.

**Figure 1: Typical Pinch Point Locations**

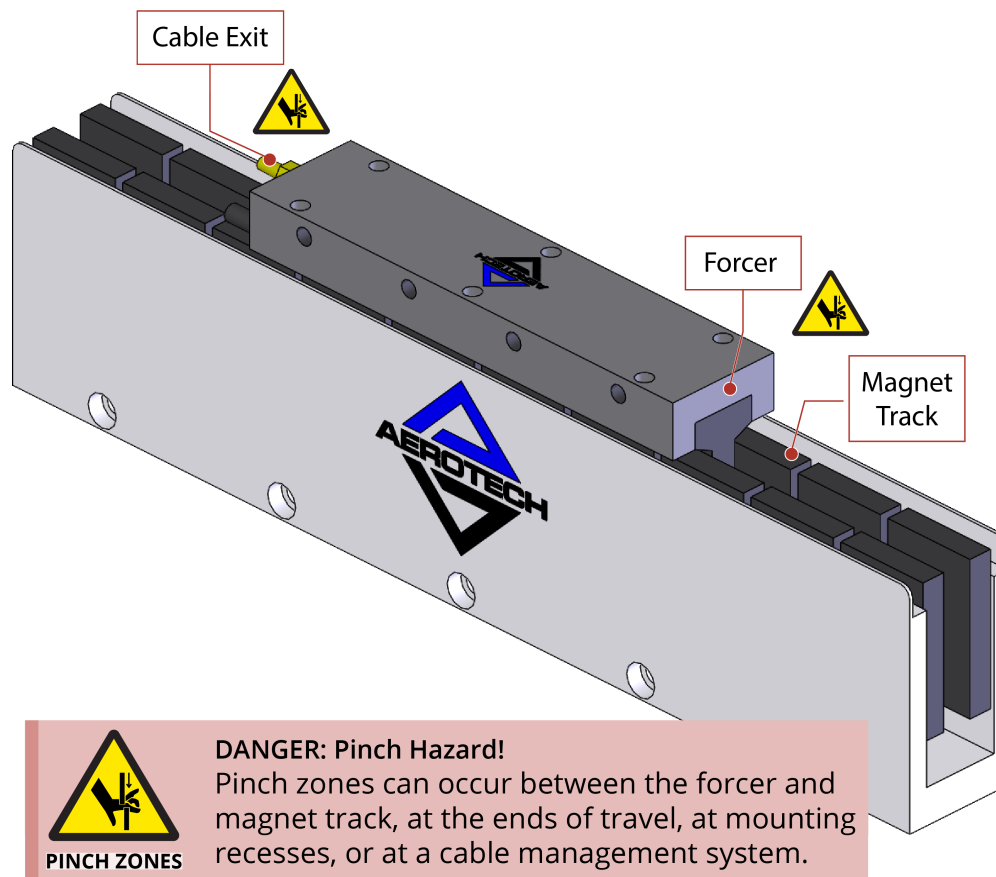

### **DANGER: Pinch Hazard!**

Pinch zones can occur between the forcer and magnet track, at the ends of travel, at mounting recesses, or at a cable management system.

## Magnetic Hazards

The magnet track will be exposed during normal operation or when you do maintenance to the system.




### **DANGER: Magnetic Field Hazard!**

- Only qualified, trained personnel should be allowed to have access to exposed magnet tracks during setup or when you do maintenance.
- Strong magnetic fields are present near and inside the magnet track assembly.
- Do not disassemble the magnet track components. If you do so, you will expose yourself to mechanical crush, pinch, or impact hazards.
- Magnetic fields could interfere with external or internal medical devices (pacemakers, for example).
- Magnetic fields can create mechanical hazards (crush, impact, or pinch points, for example).
- Loose items such as metallic tools, watches, or keys could get drawn into and damage the magnet track assembly.



**IMPORTANT:** Use non-magnetic tools when you install or do service to the stage.

**Figure 2: Exposed Magnet Locations**

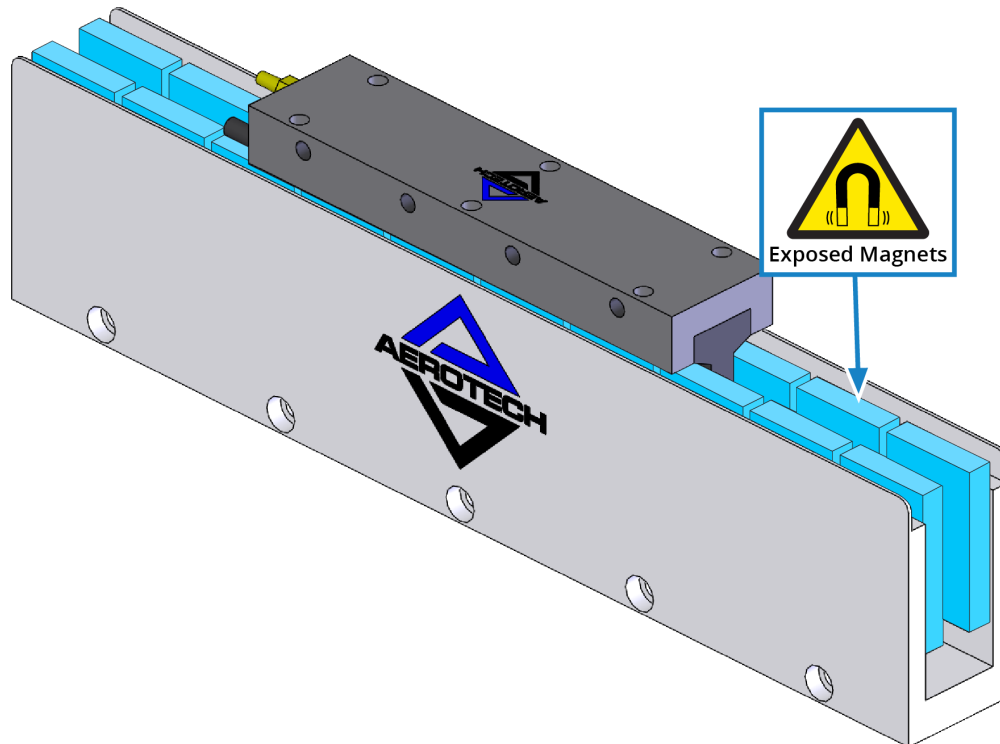

## Handling and Storage



**IMPORTANT:** It is the responsibility of the customer to safely and carefully lift and move the motor.

- Be careful when you move or transport the motor.
- Retain the shipping materials for future use.
- Transport or store the motor in its protective packaging.



**WARNING: Electrostatic Discharge (ESD) Sensitive Components!**

Wear an ESD wrist strap when you handle, install, or do service to the system assembly. You could damage the power supply or drives if you fail to observe the correct ESD practices.

Inspect the shipping container for any evidence of shipping damage. If any damage exists, notify the shipping carrier immediately.

Remove the packing list from the shipping container. Make sure that all the items specified on the packing list are contained within the package.

The documentation for the motor is on the included installation device. The documents include manuals, interconnection drawings, and other system documentation. Save this information for future reference.

Each motor has a label listing the system part number and serial number. These numbers contain information necessary for maintenance or system hardware and software updates. Locate this label and record the information for later reference.

## Unpacking and Handling

It is the responsibility of the customer to safely and carefully lift and move the motor.



**IMPORTANT:** All electronic equipment and instrumentation is wrapped in antistatic material and packaged with desiccant. Ensure that the antistatic material is not damaged during unpacking.



**DANGER: Lifting Hazard!** Use care when you move the motor or you could negatively affect the performance of it.

- Use the correct lifting techniques, mechanical assistance, or additional help to lift or move this product.
- Do not use the cables or the connectors to lift or move this product.
- Make sure that all moving parts are secure before you move the motor. Unsecured moving parts could shift and cause injury or damage to the equipment.
- If the motor is heavy, a single person lift could cause injury. Use assistance when you lift or move it.
  - Refer to [Section 1.2. Dimensions](#) for dimensions
  - Refer to [Section 1.1. Motor Specifications](#) for weight specifications.

Carefully remove the motor from its protective shipping container.

- Lift this product only by the base.
- Use a cart, dolly, or similar device to move the motor to a new location.

Gently set the motor on a smooth, flat, and clean surface. Use compressed nitrogen or clean, dry, oil-free air to remove any dust or debris that has collected during shipping.

Before you operate the motor, let it stabilize at room temperature for at least 12 hours. This will ensure that all of the alignments, preloads, and tolerances are the same as they were when they were tested at Aerotech.

**Storage**

Store the motor in the original shipping container. If the original packaging included ESD protective packaging, make sure to store the motor in it. The storage location must be dry, free of dust, free of vibrations, and flat.

Refer to [Section 1.3. Environmental Specifications](#)



## Chapter 1: Overview

**Table 1-1: BLMSC Options**

<b>BLMSC Brushless Linear Servomotor</b>	
BLMSC-111	111 mm long linear motor forcer with thermistor
<b>Winding Option (Required)</b>	
-A	Standard
<b>Cooling Option (Required)</b>	
-NC	No air cooling (standard)
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MTSC64P	64 mm long magnet track
MTSC96P	96 mm long magnet track
MTSC112P	112 mm long magnet track
MTSC128P	128 mm long magnet track
MTSC144P	144 mm long magnet track
MTSC160P	160 mm long magnet track
MTSC192P	192 mm long magnet track
MTSC224P	224 mm long magnet track
MTSC256P	256 mm long magnet track
MTSC288P	288 mm long magnet track
MTSC352P	352 mm long magnet track
MTSC400P	400 mm long magnet track
MTSC416P	416 mm long magnet track
MTSC#P	Custom length magnet track
NOTE: Magnet tracks are ordered as separate line items.	

**Table 1-2: BLMUC Options**

<b>BLMUC Brushless Linear Servomotor</b>	
BLMUC-79	79 mm long linear motor forcer with thermistor
BLMUC-95	95 mm long linear motor forcer with thermistor
BLMUC-111	111 mm long linear motor forcer with thermistor
BLMUC-143	143 mm long linear motor forcer with thermistor
<b>Winding Option (Required)</b>	
-A	Standard
<b>Cooling Options (Required)</b>	
-NC	No air-cooling fitting
-AC	With air-cooling fitting; not available with -V option
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Motor Preparation Options (Required)</b>	
-S	Standard motor preparation
-V	Vacuum preparation for $10^{-6}$ Torr
-UHV	Ultra-high vacuum preparation, contact the factory
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MTUC64P   S	64 mm long magnet track
MTUC96P   S	96 mm long magnet track
MTUC112P   S	112 mm long magnet track
MTUC128P   S	128 mm long magnet track
MTUC144P   S	144 mm long magnet track
MTUC160P   S	160 mm long magnet track
MTUC192P   S	192 mm long magnet track
MTUC224P   S	224 mm long magnet track
MTUC256P   S	256 mm long magnet track
MTUC288P   S	288 mm long magnet track
MTUC352P   S	352 mm long magnet track
MTUC400P   S	400 mm long magnet track
MTUC416P   S	416 mm long magnet track
MTUC#P   S	Custom length magnet track
NOTE: Magnet tracks are ordered as separate line items.	
<ul style="list-style-type: none"> <li>• Magnet track part numbers ending with "P" are high performance grade and include magnets on both sides of the track. Example: MTUC64P</li> <li>• Magnet track numbers ending with "S" are standard performance grade and include magnets on a single side of the track. Example: MTUC96S</li> </ul>	

**Table 1-3: BLMC Forcer Options**

<b>BLMC Brushless Linear Servomotor</b>	
BLMC-92	92 mm long linear motor forcer with thermistor
BLMC-142	142 mm long linear motor forcer with thermistor
BLMC-192	192 mm long linear motor forcer with thermistor
BLMC-267	267 mm long linear motor forcer with thermistor
<b>Winding Option (Required)</b>	
-A	Standard
<b>Cooling Options (Required)</b>	
-NC	No air-cooling fitting
-ACC	With a rear center air-cooling fitting; not available with -V option
-ACL	With a rear left-side air-cooling fitting; not available with -V option
-ACR	With a rear right-side air-cooling fitting; not available with -V option
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Motor Preparation Options (Required)</b>	
-S	Standard motor preparation
-V	Vacuum preparation for $10^{-6}$ Torr
-UHV	Ultra-high vacuum preparation, contact the factory
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MTC100P S	100 mm long compact magnet track
MTC150P S	150 mm long compact magnet track
MTC175P S	175 mm long compact magnet track
MTC200P S	200 mm long compact magnet track
MTC250P S	250 mm long compact magnet track
MTC300P S	300 mm long compact magnet track
MTC350P S	350 mm long compact magnet track
MTC425P S	425 mm long compact magnet track
MTC450P S	450 mm long compact magnet track
MTC500P S	500 mm long compact magnet track
MTC#P S	Custom length compact magnet track
NOTE: Magnet tracks are ordered as separate line items.	
<ul style="list-style-type: none"> <li>Magnet track part numbers ending with "P" are high performance grade and include magnets on both sides of the track. Example: MTC300P</li> <li>Magnet track numbers ending with "S" are standard performance grade and include magnets on a single side of the track. Example: MTC350S</li> </ul>	

**Table 1-4: BLM Options**

<b>BLM Brushless Linear Servomotor</b>	
BLM-142	142 mm long linear motor forcer with thermistor
BLM-203	203 mm long linear motor forcer with thermistor
BLM-264	264 mm long linear motor forcer with thermistor
BLM-325	325 mm long linear motor forcer with thermistor
BLM-386	386 mm long linear motor forcer with thermistor
BLM-X	Custom length linear motor forcer with thermistor
<b>Winding Options (Required)</b>	
-A	Standard
NOTE: Alternate winding options are available. Contact Aerotech for more information.	
<b>Cooling Options (Required)</b>	
-NC	No air-cooling fitting
-AC	With air-cooling fitting; not available with -V option
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Motor Preparation Options (Required)</b>	
-S	Standard motor preparation
-V	Vacuum preparation for $10^{-6}$ Torr
-UHV	Ultra-high vacuum preparation, contact the factory
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MT180P S	180 mm length magnet track
MT240P S	240 mm length magnet track
MT300P S	300 mm length magnet track
MT330P S	330 mm length magnet track
MT360P S	360 mm length magnet track
MT420P S	420 mm length magnet track
MT480P S	480 mm length magnet track
MT540P S	540 mm length magnet track
MT600P S	600 mm length magnet track
MT#P S	Custom length magnet track
NOTE: Magnet tracks are ordered as separate line items.	
<ul style="list-style-type: none"> <li>Magnet track part numbers ending with "P" are high performance grade and include magnets on both sides of the track. Example: MT360P</li> <li>Magnet track numbers ending with "S" are standard performance grade and include magnets on a single side of the track. Example: MT420S</li> </ul>	

**Table 1-5: BLMH Options**

<b>BLMH Brushless Linear Servomotor</b>	
BLMH-142	142 mm long linear motor forcer with thermistor
BLMH-262	262 mm long linear motor forcer with thermistor
BLMH-382	382 mm long linear motor forcer with thermistor
<b>Winding Options (Required)</b>	
-A	Standard
NOTE: Alternate winding options are available. Contact Aerotech for more information.	
<b>Cooling Options (Required)</b>	
-NC	No air-cooling fitting
-AC	With air-cooling fitting; not available with -V option
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Motor Preparation Options (Required)</b>	
-S	Standard motor preparation
-V	Vacuum preparation for $10^{-6}$ Torr
-UHV	Ultra-high vacuum preparation, contact the factory
<b>Bus Voltage Selection</b>	
-VT1	Low voltage model
-VT2	High voltage model
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MTH180P	180 mm long magnet track
MTH210P	210 mm long magnet track
MTH240P	240 mm long magnet track
MTH300P	300 mm long magnet track
MTH330P	330 mm long magnet track
MTH360P	360 mm long magnet track
MTH480P	480 mm long magnet track
MTH600P	600 mm long magnet track
MTH720P	720 mm long magnet track
MTH#P	Custom length magnet track
NOTE: Magnet tracks are ordered as separate line items.	

**Table 1-6: BLMX Options**

<b>BLMX Brushless Linear Servomotor</b>	
BLMX-382	382 mm long linear motor forcer with thermistor
BLMX-502	502 mm long linear motor forcer with thermistor
<b>Winding Options (Required)</b>	
-A	Standard
NOTE: Alternate winding options are available. Contact Aerotech for more information.	
<b>Cooling Options (Required)</b>	
-NC	No air-cooling fitting
-AC	With air-cooling fitting; not available with -V option
<b>Hall-Effect Sensor Options (Required)</b>	
-NH	No Hall-effect sensors
-H	With Hall-effect sensors
<b>Motor Preparation Options (Required)</b>	
-S	Standard motor preparation
-V	Vacuum preparation for $10^{-6}$ Torr
-UHV	Ultra-high vacuum preparation, contact the factory
<b>Bus Voltage Selection</b>	
-VT1	Low voltage model
-VT2	High voltage model
<b>Cable Length Options (Required)</b>	
-750	750 mm of high-flex cable
-5000	5.0 m of high-flex cable
<b>Magnet Track Options (Optional)</b>	
MTX480P	480 mm (18.9 in) long magnet track
MTX600P	600 mm (23.6 in) long magnet track
MTX720P	720 mm (28.4 in) long magnet track
MTX#P	Custom length magnet track
NOTE: Magnet tracks are ordered as separate line items.	

## 1.1. Motor Specifications

**Table 1-7: BLMSC Motor Specifications**

		<b>BLMSC-111</b>
<b>Performance Specifications</b>		
Continuous Force	N (lb)	20.8 (4.7)
Peak Force	N (lb)	83.3 (18.7)
<b>Electrical Specifications</b>		
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	9.2 (0.23)
Continuous Current	$A_{pk}$ ( $A_{rms}$ )	2.67 (1.89)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	10.68 (7.55)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	7.8 (1.75)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	11.03 (2.48)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	2.91 (0.65)
Resistance, 25 °C (line-line)	$\Omega$	6.8
Inductance (line-line)	mH	1.02
Thermal Resistance	°C/W	1.95
Maximum Bus Voltage	$V_{DC}$	340
<b>Mechanical Specifications</b>		
Coil Weight	kg (lb)	0.13 (0.29)
Coil Length	mm (in)	111 (4.37)
Heat Sink	mm <sup>3</sup> (in <sup>3</sup> )	250×250×25 (10×10×1)
Magnet Track Weight	kg/m (lb/ft)	2.81 (1.88)
Magnetic Pole Pitch	mm (in)	16.0 (0.63)
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of ±10%.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>		

**Table 1-8: BLMUC Motor Specifications (P Magnet Track)**

		BLMUC-79	BLUM-95	BLMUC-111	BLMUC-143
<b>Performance Specifications</b>					
Continuous Force, 1.4 bar (20 psi)	N (lb)	31.4 (7.0)	40.5 (9.1)	46.9 (10.5)	58.0 (13.0)
Continuous Force, No Forced Cooling	N (lb)	18.3 (4.1)	23.0 (5.2)	30.6 (6.9)	39.8 (9.0)
Peak Force	N (lb)	125.4 (28.2)	161.9 (36.4)	187.6 (42.2)	231.8 (52.1)
<b>Electrical Specifications</b>					
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	6.80 (0.17)	9.00 (0.23)	11.35 (0.29)	15.90 (0.40)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	5.30 (3.75)	5.17 (3.66)	4.75 (3.36)	4.19 (2.96)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	3.10 (2.19)	2.94 (2.08)	3.10 (2.19)	2.88 (2.04)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	21.20 (14.99)	20.68 (14.62)	19.00 (13.44)	16.76 (11.85)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	5.92 (1.33)	7.83 (1.76)	9.87(2.22)	13.83 (3.11)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	8.37 (1.88)	11.07 (2.49)	13.96 (3.14)	19.56 (4.40)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	2.89 (0.65)	3.35 (0.75)	3.78 (0.85)	4.53 (1.02)
Resistance, 25 °C (line-line)	$\Omega$	4.0	5.2	6.5	8.9
Inductance (line-line)	mH	0.51	0.70	0.87	1.10
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.85	0.69	0.65	0.61
Thermal Resistance, No Forced Cooling	°C/W	2.48	2.12	1.52	1.29
Maximum Bus Voltage	$V_{DC}$	340	340	340	340
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.5 \times 10^{-3}$ (3.12)	$1.5 \times 10^{-3}$ (3.15)	$1.5 \times 10^{-3}$ (3.22)	$1.5 \times 10^{-3}$ (3.12)
Coil Weight	kg (lb)	0.10 (0.22)	0.12 (0.26)	0.14 (0.31)	0.20 (0.44)
Coil Length	mm (in)	80.0 (3.15)	96.0 (3.78)	112.0 (4.41)	144.0 (5.67)
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)
Magnet Track Weight	kg/m (lb/ft)	3.33 (2.23)	3.33 (2.23)	3.33 (2.23)	3.33 (2.23)
Magnetic Pole Pitch	mm (in)	16.00 (0.63)	16.00 (0.63)	16.00 (0.63)	16.00 (0.63)
(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.					
(2) All performance and electrical specifications have a tolerance of $\pm 10\%$ .					
(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.					
(4) Peak force assumes correct rms current; consult Aerotech.					
(5) Force constant and motor constant specified at stall					
(6) All Aerotech amplifiers are rated $A_{pk}$ ; use force constant in $N/A_{pk}$ when sizing.					



**Table 1-9: BLMUC Motor Specifications (S Magnet Track)**

		BLMUC-79	BLMUC-95	BLMUC-111	BLMUC-143
<b>Performance Specifications</b>					
Continuous Force, 1.4 bar (20 psi)	N (lb)	20.7 (4.7)	26.7 (6.0)	31.0 (7.0)	38.3 (8.6)
Continuous Force, No Forced Cooling	N (lb)	12.1 (2.7)	15.2 (3.4)	20.2 (4.5)	26.3 (5.9)
Peak Force	N (lb)	82.8 (18.6)	106.8 (24.0)	123.8 (27.8)	153.0 (34.4)
<b>Electrical Specifications</b>					
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	4.49 (0.11)	5.94 (0.15)	7.49 (0.19)	10.49 (0.27)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	5.30 (3.75)	5.17 (3.66)	4.75 (3.36)	4.19 (2.96)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	3.10 (2.19)	2.94 (2.08)	3.10 (2.19)	2.88 (2.04)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	21.20 (14.99)	20.68 (14.62)	19.00 (13.44)	16.76 (11.85)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	3.90 (0.88)	5.17 (1.16)	6.52 (1.47)	9.13 (2.05)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	5.52 (1.24)	7.31 (1.64)	9.22 (2.07)	12.91 (2.90)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	1.91 (0.43)	2.21 (0.50)	2.49 (0.56)	2.99 (0.67)
Resistance, 25 °C (line-line)	$\Omega$	4.0	5.2	6.5	8.9
Inductance (line-line)	mH	0.51	0.70	0.87	1.10
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.85	0.69	0.65	0.61
Thermal Resistance, No Forced Cooling	°C/W	2.48	2.12	1.52	1.29
Maximum Bus Voltage	$V_{DC}$	340	340	340	340
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.5 \times 10^{-3}$ (3.12)	$1.5 \times 10^{-3}$ (3.15)	$1.5 \times 10^{-3}$ (3.22)	$1.5 \times 10^{-3}$ (3.12)
Coil Weight	kg (lb)	0.10 (0.22)	0.12 (0.26)	0.14 (0.31)	0.20 (0.44)
Coil Length	mm (in)	80.0 (3.15)	96.0 (3.78)	112.0 (4.41)	144.0 (5.67)
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)
Magnet Track Weight	kg/m (lb/ft)	3.59 (2.41)	3.59 (2.41)	3.59 (2.41)	3.59 (2.41)
Magnetic Pole Pitch	mm (in)	16.00 (0.63)	16.00 (0.63)	16.00 (0.63)	16.00 (0.63)
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>					

**Table 1-10: BLMC Motor Specifications (P Magnet Track)**

		BLMC-92	BLMC-142	BLMC-192	BLMC-267
<b>Performance Specifications</b>					
Continuous Force, 1.4 bar (20 psi)	N (lb)	75.1 (16.9)	120.3 (27.0)	154.7 (34.8)	184.0 (41.4)
Continuous Force, No Forced Cooling	N (lb)	44.5 (10.0)	77.7 (17.5)	106.7 (24.0)	123.5 (27.8)
Peak Force	N (lb)	300.6 (67.6)	481.2 (108.2)	618.8 (139.1)	736.0 (165.5)
<b>Electrical Specifications</b>					
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	11.37 (0.29)	21.28 (0.54)	30.66 (0.78)	41.15 (1.05)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	7.60 (5.37)	6.50 (4.60)	5.80 (4.10)	5.14 (3.63)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	4.50 (3.18)	4.20 (2.97)	4.00 (2.83)	3.45 (2.44)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	30.40 (21.50)	26.00 (18.38)	23.20 (16.40)	20.56 (14.54)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	9.89 (2.22)	18.51 (4.16)	26.67 (6.00)	35.80 (8.05)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	13.98 (3.14)	26.17 (5.88)	37.72 (8.48)	50.63 (11.38)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	5.67 (1.27)	8.24 (1.85)	10.29 (2.31)	11.52 (2.59)
Resistance, 25 °C (line-line)	$\Omega$	2.9	4.8	6.4	9.2
Inductance (line-line)	mH	0.83	1.33	1.90	3.40
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.57	0.47	0.44	0.39
Thermal Resistance, No Forced Cooling	°C/W	1.62	1.12	0.93	0.87
Maximum Bus Voltage	$V_{DC}$	340	340	340	340
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.4 \times 10^{-3}$ (2.9)	$1.7 \times 10^{-3}$ (3.6)	$1.4 \times 10^{-3}$ (2.9)	$1.5 \times 10^{-3}$ (3.2)
Coil Weight	kg (lb)	0.16 (0.35)	0.26 (0.57)	0.34 (0.75)	0.52 (1.14)
Coil Length	mm (in)	91.0 (3.58)	142.0 (5.59)	192.0 (7.56)	267.0 (10.51)
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)
Magnet Track Weight	kg/m (lb/ft)	6.59 (4.42)	6.59 (4.42)	6.59 (4.42)	6.59 (4.42)
Magnetic Pole Pitch	mm (in)	25 (0.98)	25 (0.98)	25 (0.98)	25 (0.98)
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>					

**Table 1-11: BLMC Motor Specifications (S Magnet Track)**

		BLMC-92	BLMC-142	BLMC-192	BLMC-267
<b>Performance Specifications</b>					
Continuous Force, 1.4 bar (20 psi)	N (lb)	54.1 (12.2)	86.6 (19.5)	111.4 (25.0)	132.5 (29.8)
Continuous Force, No Forced Cooling	N (lb)	32.0 (7.2)	56.0 (12.6)	76.8 (17.3)	88.9 (20.0)
Peak Force	N (lb)	216.4 (48.7)	346.5 (77.9)	445.5 (100.2)	529.9 (119.1)
<b>Electrical Specifications</b>					
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	8.18 (0.21)	15.32 (0.39)	22.07 (0.56)	29.63 (0.75)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	7.60 (5.37)	6.50 (4.60)	5.80 (4.10)	5.14 (3.63)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	4.50 (3.18)	4.20 (2.97)	4.00 (2.83)	3.45 (2.44)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	30.40 (21.50)	26.00 (18.38)	23.20 (16.40)	20.56 (14.54)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	7.12 (1.60)	13.33 (3.00)	19.20 (4.32)	25.78 (5.79)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	10.07 (2.26)	18.85 (4.24)	27.16 (6.11)	36.45 (8.20)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	4.08 (0.92)	5.94 (1.33)	7.41 (1.67)	8.29 (1.86)
Resistance, 25 °C (line-line)	$\Omega$	2.9	4.8	6.4	9.2
Inductance (line-line)	mH	0.83	1.33	1.90	3.40
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.57	0.47	0.44	0.39
Thermal Resistance, No Forced Cooling	°C/W	1.62	1.12	0.93	0.87
Maximum Bus Voltage	$V_{DC}$	340	340	340	340
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.4 \times 10^{-3}$ (2.9)	$1.7 \times 10^{-3}$ (3.6)	$1.4 \times 10^{-3}$ (2.9)	$1.5 \times 10^{-3}$ (3.2)
Coil Weight	kg (lb)	0.16 (0.35)	0.26 (0.57)	0.34 (0.75)	0.52 (1.14)
Coil Length	mm (in)	91.0 (3.58)	142.0 (5.59)	192.0 (7.56)	267.0 (10.51)
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)	250×250×25 (10×10×1)
Magnet Track Weight	kg/m (lb/ft)	7.11 (4.76)	7.11 (4.76)	7.11 (4.76)	7.11 (4.76)
Magnetic Pole Pitch	mm (in)	25 (0.98)	25 (0.98)	25 (0.98)	25 (0.98)
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>					

**Table 1-12: BLM Motor Specifications (P Magnet Track, BLM-142, BLM-203, BLM-264)**

		BLM-142		BLM-203		BLM-264	
<b>Performance Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	173.2 (38.9)	158.7 (35.7)	251.6 (56.6)		301.7 (67.8)	
Continuous Force, No Forced Cooling	N (lb)	110.5 (24.8)		153.3 (34.5)		197.2 (44.3)	
Peak Force	N (lb)	692.7 (155.7)		1006.4 (226.3)		1206.6 (271.3)	
<b>Electrical Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	40.96 (1.04)	20.48 (0.52)	33.24 (0.84)	66.49 (1.69)	44.46 (1.13)	88.91 (2.26)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	4.86 (3.44)	8.91 (6.30)	8.70 (6.15)	4.35 (3.08)	7.80 (5.52)	3.90 (2.76)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	3.10 (2.19)	6.20 (4.38)	5.30 (3.75)	2.65 (1.87)	5.10 (3.61)	2.55 (1.80)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	19.44 (13.75)	38.88 (27.49)	34.80 (24.61)	17.40 (12.30)	31.20 (22.06)	15.60 (11.03)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	35.63 (8.01)	17.82 (4.01)	28.92 (6.50)	57.84 (13.00)	38.67 (8.69)	77.35 (17.39)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	50.39 (11.33)	25.20 (5.66)	40.90 (9.19)	81.80 (18.39)	54.69 (12.30)	109.39 (24.59)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	10.53 (2.37)		14.11 (3.17)		16.39 (3.69)	
Resistance, 25 °C (line-line)	$\Omega$	10.9	2.7	4.0	16.0	5.3	21.2
Inductance (line-line)	mH	8.70	2.18	3.20	12.80	4.20	16.80
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.37		0.31		0.30	
Thermal Resistance, No Forced Cooling	°C/W	0.91		0.85		0.69	
Maximum Bus Voltage	$V_{DC}$	340		340		340	
<b>Mechanical Specifications</b>							
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.7 \times 10^{-3}$ (3.50)		$1.5 \times 10^{-3}$ (3.20)		$1.6 \times 10^{-3}$ (3.30)	
Coil Weight	kg (lb)	0.60 (1.32)		0.90 (1.98)		1.10 (2.42)	
Coil Length	mm (in)	143.8 (5.66)		204.7 (8.06)		265.7 (10.46)	
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)		250×250×25 (10×10×1)		250×250×25 (10×10×1)	
Magnet Track Weight	kg/m (lb/ft)	10.12 (6.79)		10.12 (6.79)		10.12 (6.79)	
Magnetic Pole Pitch	mm (in)	30.48 (1.20)		30.48 (1.20)		30.48 (1.20)	
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>							

**Table 1-13: BLM Motor Specifications (P Magnet Track, BLM-325, BLM-386)**

		BLM-325		BLM-386	
<b>Performance Specifications</b>					
Winding Designation		-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	332.2 (74.7)		397.6 (89.4)	
Continuous Force, No Forced Cooling	N (lb)	230.7 (51.9)		257.3 (57.8)	
Peak Force	N (lb)	1328.6 (298.7)		1590.4 (357.5)	
<b>Electrical Specifications</b>					
Winding Designation		-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	53.03 (1.35)	106.6 (2.69)	67.21 (1.71)	134.42 (3.41)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	7.20 (5.09)	3.60 (2.55)	6.80 (4.81)	3.40 (2.40)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	5.00 (3.54)	2.50 (1.77)	4.40 (3.11)	2.20 (1.56)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	28.80 (20.36)	14.40 (10.18)	27.20 (19.23)	13.60 (9.62)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	46.13 (10.37)	92.27 (20.74)	58.47 (13.15)	116.94 (26.29)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	65.24 (14.67)	130.48 (29.34)	82.69 (18.59)	165.38 (37.18)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	17.66 (3.97)		20.17 (4.54)	
Resistance, 25 °C (line-line)	$\Omega$	6.5	26.0	8.0	32.0
Inductance (line-line)	mH	5.20	20.80	6.20	24.80
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.28		0.26	
Thermal Resistance, No Forced Cooling	°C/W	0.59		0.61	
Maximum Bus Voltage	$V_{DC}$	340		340	
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.6 \times 10^{-3}$ (3.30)		$1.6 \times 10^{-3}$ (3.40)	
Coil Weight	kg (lb)	1.40 (3.08)		1.70 (3.74)	
Coil Length	mm (in)	326.6 (12.86)		387.6 (15.26)	
Heat Sink	$mm^3$ ( $in^3$ )	250×400×25 (10×16×1)		250×400×25 (10×16×1)	
Magnet Track Weight	kg/m (lb/ft)	10.12 (6.79)		10.12 (6.79)	
Magnetic Pole Pitch	mm (in)	30.48 (1.20)		30.48 (1.20)	
(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.					
(2) All performance and electrical specifications have a tolerance of ±10%.					
(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.					
(4) Peak force assumes correct rms current; consult Aerotech.					
(5) Force constant and motor constant specified at stall					
(6) All Aerotech amplifiers are rated $A_{pk}$ ; use force constant in $N/A_{pk}$ when sizing.					

**Table 1-14: BLM Motor Specifications (S Magnet Track, BLM-142, BLM-203, BLM-264)**

		BLM-142		BLM-203		BLM-264	
<b>Performance Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	108.9 (24.5)	99.8 (22.4)	158.2 (35.6)		189.6 (42.6)	
Continuous Force, No Forced Cooling	N (lb)	69.4 (15.6)		96.4 (21.7)		124.0 (27.9)	
Peak Force	N (lb)	435.5 (97.9)		632.7 (142.2)		758.6 (170.5)	
<b>Electrical Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	25.75 (0.65)	12.88 (0.33)	20.90 (0.53)	41.80 (1.06)	27.95 (0.71)	55.90 (1.42)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	4.86 (3.44)	8.91 (6.30)	8.70 (6.15)	4.35 (3.08)	7.80 (5.52)	3.90 (2.76)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	3.10 (2.19)	6.20 (4.38)	5.30 (3.75)	2.65 (1.87)	5.10 (3.61)	2.55 (1.80)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	19.44 (13.75)	38.88 (27.49)	34.80 (24.61)	17.40 (12.30)	31.20 (22.06)	15.60 (11.03)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	22.40 (5.04)	11.20 (2.52)	18.18 (4.09)	36.36 (8.17)	24.31 (5.47)	48.63 (10.93)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	31.68 (7.12)	15.84 (3.56)	25.71 (5.78)	51.42 (11.56)	34.38 (7.73)	68.77 (15.46)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	6.62 (1.49)		8.87 (1.99)		10.31 (2.32)	
Resistance, 25 °C (line-line)	$\Omega$	10.9	2.7	4.0	16.0	5.3	21.2
Inductance (line-line)	mH	8.7	2.2	3.2	12.8	4.2	16.8
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.37		0.31		0.30	
Thermal Resistance, No Forced Cooling	°C/W	0.91		0.85		0.69	
Maximum Bus Voltage	$V_{DC}$	340		340		340	
<b>Mechanical Specifications</b>							
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.7 \times 10^{-3}$ (3.50)		$1.5 \times 10^{-3}$ (3.20)		$1.6 \times 10^{-3}$ (3.30)	
Coil Weight	kg (lb)	0.60 (1.32)		0.90 (1.98)		1.10 (2.42)	
Coil Length	mm (in)	143.8 (5.66)		204.7 (8.06)		265.7 (10.46)	
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)		250×250×25 (10×10×1)		250×250×25 (10×10×1)	
Magnet Track Weight	kg/m (lb/ft)	10.92 (7.32)		10.92 (7.32)		10.92 (7.32)	
Magnetic Pole Pitch	mm (in)	30.48 (1.20)		30.48 (1.20)		30.48 (1.20)	
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of ±10%.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>							

**Table 1-15: BLM Motor Specifications (S Magnet Track, BLM-325, BLM-386)**

		BLM-325		BLM-386	
<b>Performance Specifications</b>					
Winding Designation		-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	208.8 (46.9)		250.0 (56.2)	
Continuous Force, No Forced Cooling	N (lb)	145.0 (32.6)		161.7 (36.4)	
Peak Force	N (lb)	835.3 (187.8)		999.8 (224.8)	
<b>Electrical Specifications</b>					
Winding Designation		-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	33.34 (0.85)	66.68 (1.69)	42.25 (1.07)	84.51 (2.15)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	7.20 (5.09)	3.60 (2.55)	6.80 (4.81)	3.40 (2.40)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	5.00 (3.54)	2.50 (1.77)	4.40 (3.11)	2.20 (1.56)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	28.80 (20.36)	14.40 (10.18)	27.20 (19.23)	13.60 (9.62)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	29.00 (6.52)	58.01 (13.04)	36.76 (8.26)	73.52 (16.53)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	41.02 (9.22)	82.03 (18.44)	51.98 (11.69)	103.97 (23.37)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	11.10 (2.50)		12.68 (2.85)	
Resistance, 25 °C (line-line)	$\Omega$	6.5	26.0	8.0	32.0
Inductance (line-line)	mH	5.2	20.8	6.2	24.8
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.28		0.26	
Thermal Resistance, No Forced Cooling	°C/W	0.59		0.61	
Maximum Bus Voltage	$V_{DC}$	340		340	
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$1.6 \times 10^{-3}$ (3.30)		$1.6 \times 10^{-3}$ (3.40)	
Coil Weight	kg (lb)	1.40 (3.08)		1.70 (3.74)	
Coil Length	mm (in)	326.6 (12.86)		387.6 (15.26)	
Heat Sink	$mm^3$ ( $in^3$ )	250×400×25 (10×16×1)		250×400×25 (10×16×1)	
Magnet Track Weight	kg/m (lb/ft)	10.92 (7.32)		10.92 (7.32)	
Magnetic Pole Pitch	mm (in)	30.48 (1.20)		30.48 (1.20)	
(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.					
(2) All performance and electrical specifications have a tolerance of ±10%.					
(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.					
(4) Peak force assumes correct rms current; consult Aerotech.					
(5) Force constant and motor constant specified at stall					
(6) All Aerotech amplifiers are rated $A_{pk}$ ; use force constant in $N/A_{pk}$ when sizing.					

**Table 1-16: BLMH Motor Specifications**

		BLMH-142		BLMH-262		BLMH-382	
<b>Performance Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	270.7 (60.9)		437.1 (98.3)		435.8 (98.0)	548.8 (123.4)
Continuous Force, No Forced Cooling	N (lb)	150.0 (33.7)		266.2 (59.9)		357.9 (80.5)	
Peak Force	N (lb)	1082.7 (243.4)		1748.6 (393.1)		2195.0 (493.5)	
<b>Electrical Specifications</b>							
Winding Designation		-A	-B	-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	32.11 (0.82)	64.22 (1.63)	64.42 (1.64)	128.85 (3.27)	45.71 (1.16)	91.42 (2.32)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	9.69 (6.85)	4.85 (3.43)	7.80 (5.52)	3.90 (2.76)	10.96 (7.75)	6.90 (4.88)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	5.37 (3.80)	2.69 (1.90)	4.75 (3.36)	2.38 (1.68)	9.00 (6.36)	4.50 (3.18)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	38.76 (27.41)	19.38 (13.70)	31.20 (22.06)	15.60 (11.03)	55.20 (39.03)	27.60 (19.52)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	27.93 (6.28)	55.87 (12.56)	56.04 (12.60)	112.09 (25.20)	39.77 (8.94)	79.53 (17.88)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	39.50 (8.88)	79.01 (17.76)	79.26 (17.82)	158.52 (35.64)	56.24 (12.64)	112.47 (25.29)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	14.17 (3.19)		20.24 (4.55)		23.19 (5.21)	
Resistance, 25 °C (line-line)	$\Omega$	3.7	14.8	7.3	29.2	2.8	11.2
Inductance (line-line)	mH	2.40	9.60	4.60	18.40	1.80	7.20
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.27		0.21		0.18	
Thermal Resistance, No Forced Cooling	°C/W	0.89		0.58		0.42	
Maximum Bus Voltage	$V_{DC}$	VT1: 340   VT2: 680		VT1: 340   VT2: 680		VT1: 340   VT2: 680	
<b>Mechanical Specifications</b>							
Air Flow, 20 psi	$m^3/s$ (SCFM)	$2.5 \times 10^{-3}$ (5.30)		$2.8 \times 10^{-3}$ (5.90)		$2.7 \times 10^{-3}$ (5.80)	
Coil Weight	kg (lb)	1.10 (2.42)		2.10 (4.62)		3.10 (6.82)	
Coil Length	mm (in)	142.0 (5.59)		262.0 (10.31)		382.0 (15.04)	
Heat Sink	$mm^3$ ( $in^3$ )	250×250×25 (10×10×1)		250×250×25 (10×10×1)		250×400×25 (10×16×1)	
Magnet Track Weight	kg/m (lb/ft)	20.4 (13.68)		20.4 (13.68)		20.4 (13.68)	
Magnetic Pole Pitch	mm (in)	30.00 (1.18)		30.00 (1.18)		30.00 (1.18)	
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown @ 100 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>							




**Table 1-17: BLMX Motor Specifications**

		BLMX-382		BLMX-502	
<b>Performance Specifications</b>					
Winding Designation		-A	-B	-A	-B
Continuous Force, 1.4 bar (20 psi)	N (lb)	972 (218)		1063 (239)	1011 (227)
Continuous Force, No Forced Cooling	N (lb)	537 (121)		601 (135)	
Peak Force	N (lb)	3887 (874)		4252 (956)	
<b>Electrical Specifications</b>					
Winding Designation		-A	-B	-A	-B
BEMF Constant (line-line, max)	V/(m/s) (V/(in/s))	86.26 (2.19)	172.52 (4.38)	109.59 (2.78)	54.79 (1.39)
Continuous Current 1.4 bar (20 psi)	$A_{pk}$ ( $A_{rms}$ )	12.95 (9.16)	6.48 (4.58)	11.15 (7.88)	21.21 (15.00)
Continuous Current, No Forced Cooling	$A_{pk}$ ( $A_{rms}$ )	7.15 (5.06)	3.58 (2.53)	6.30 (4.45)	12.60 (8.91)
Peak Current, Stall	$A_{pk}$ ( $A_{rms}$ )	51.80 (36.63)	25.90 (18.31)	44.60 (31.54)	89.20 (63.08)
Force Constant, Sine Drive	$N/A_{pk}$ (lb/ $A_{pk}$ )	75.04 (16.87)	150.09 (33.74)	95.33 (21.43)	47.67 (10.72)
	$N/A_{rms}$ (lb/ $A_{rms}$ )	106.13 (23.86)	212.25 (47.72)	134.82 (30.31)	67.41 (15.16)
Motor Constant	$N/\sqrt{W}$ (lb/ $\sqrt{W}$ )	39.72 (8.93)		46.23 (10.39)	
Resistance, 25 °C (line-line)	$\Omega$	3.4	13.6	4.5	1.1
Inductance (line-line)	mH	3.00	12.00	4.00	1.00
Thermal Resistance, 1.4 bar (20 psi)	°C/W	0.12		0.12	
Thermal Resistance, No Forced Cooling	°C/W	0.40		0.39	
Maximum Bus Voltage	$V_{DC}$	VT1: 340   VT2: 680		VT1: 340   VT2: 680	
<b>Mechanical Specifications</b>					
Air Flow, 20 psi	$m^3/s$ (SCFM)	$5.4 \times 10^{-3}$ (11.5)		$5.6 \times 10^{-3}$ (11.8)	
Coil Weight	kg (lb)	3.40 (7.48)		4.45 (9.79)	
Coil Length	mm (in)	382.0 (15.04)		502.0 (19.76)	
Heat Sink	$mm^3$ ( $in^3$ )	250×400×25 (10×16×1)		250×500×25 (10×20×1)	
Magnet Track Weight	kg/m (lb/ft)	35.8 (24.01)		35.8 (24.01)	
Magnetic Pole Pitch	mm (in)	30.00 (1.18)		30.00 (1.18)	
<p>(1) Performance is dependent upon heat sink configuration, system cooling conditions, and ambient temperature.</p> <p>(2) All performance and electrical specifications have a tolerance of <math>\pm 10\%</math>.</p> <p>(3) Values shown at 65 °C rise above a 25 °C ambient temperature, with motor mounted to the specified aluminum heat sink.</p> <p>(4) Peak force assumes correct rms current; consult Aerotech.</p> <p>(5) Force constant and motor constant specified at stall</p> <p>(6) All Aerotech amplifiers are rated <math>A_{pk}</math>; use force constant in <math>N/A_{pk}</math> when sizing.</p>					

## 1.2. Dimensions

Figure 1-1: BLMSC Model Dimensions

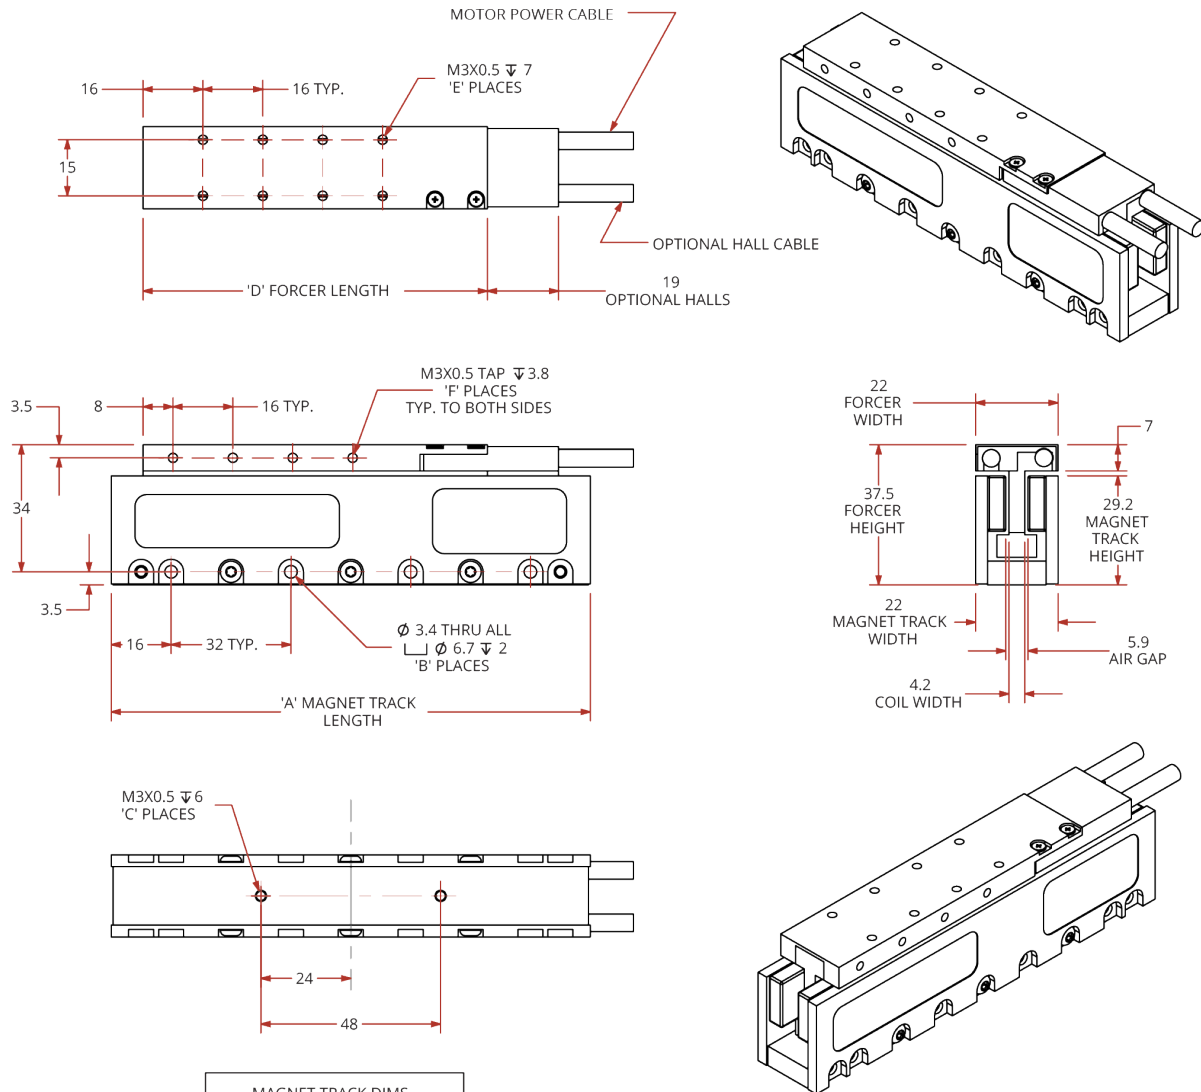


MAGNET TRACK DIMS			
PART NUMBER	A	B	C
MTSC64	64	2	0
MTSC96	96	3	2
MTSC128	128	4	2
MTSC160	160	5	2
MTSC192	192	6	4
MTSC224	224	7	4
MTSC256	256	8	4
MTSC288	288	9	6
MTSC352	352	11	6
MTSC416	416	13	8

FORCER DIMS			
PART NUMBER	D	E	F
BLMSC-111	92	8	4


(B)

DIMENSIONS: MILLIMETERS  
NOTE: BLMSC-111 FORCER SHOWN WITH MTSC128 MAGNET TRACK

**Figure 1-2: BLMUC Model Dimensions**

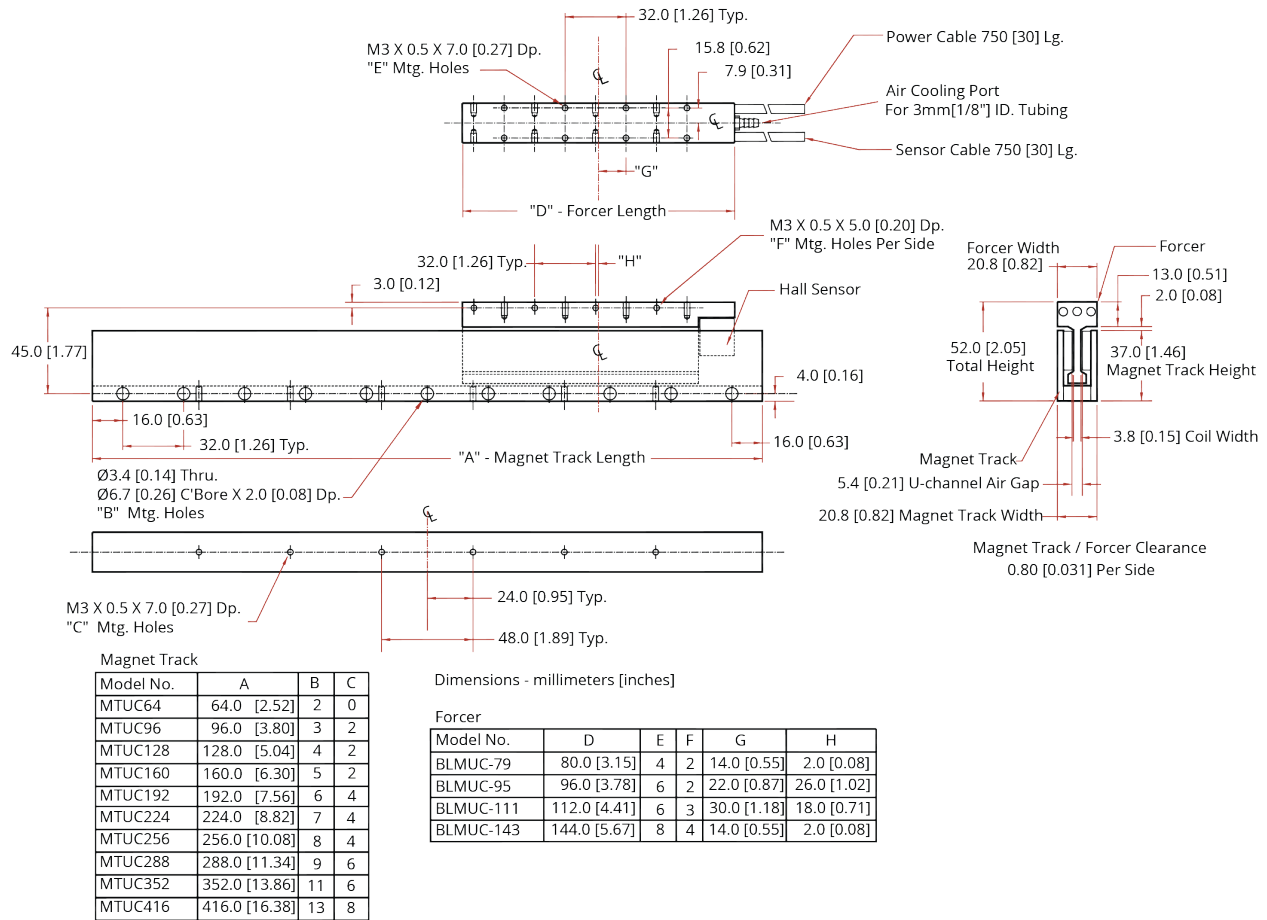

**Figure 1-3: BLMC Model Dimensions**

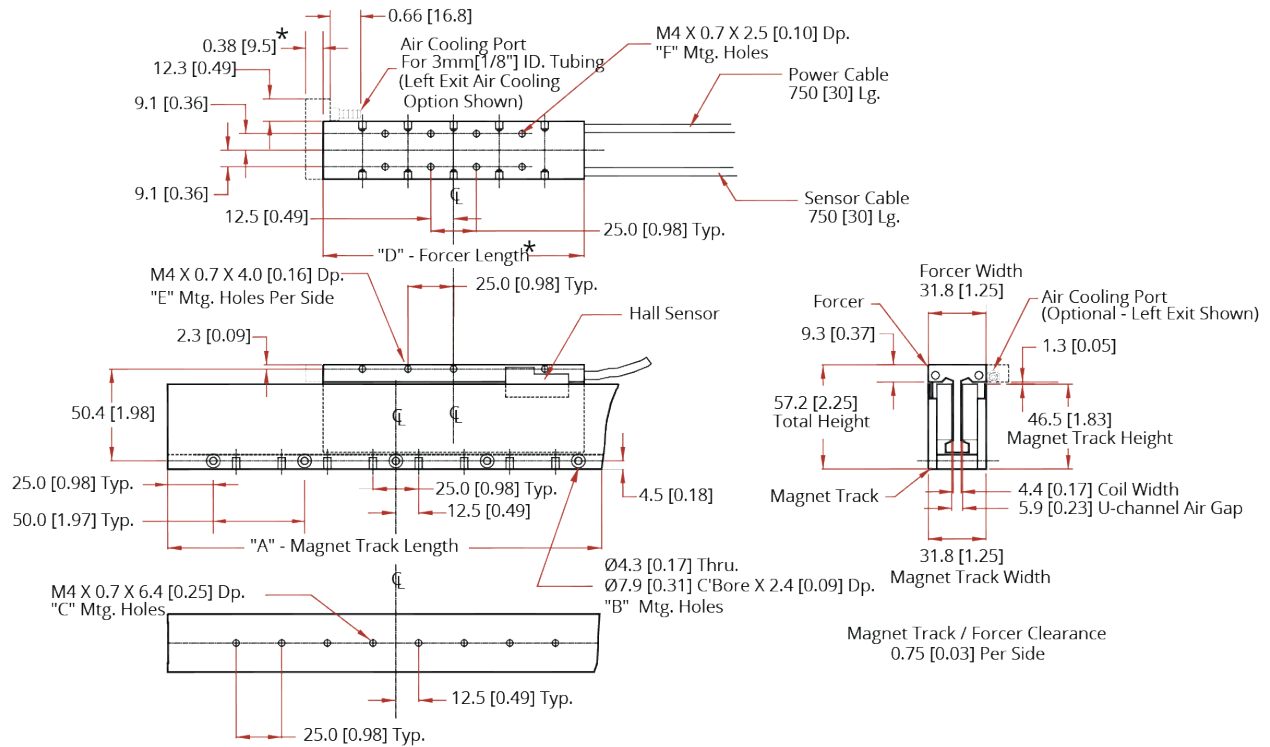

Dimensions - millimeters [inches]

Magnet Track


Model No.	A	B	C
MTC150	150.0 [5.91]	3	4
MTC250	250.0 [9.84]	5	8
MTC350	350.0 [13.78]	7	12
MTC450	450.0 [17.72]	9	16
MTC500	500.0 [19.68]	10	18

Forcer

Model No.	D	E	F
BLMC-92	93.0 [3.66]	2	4
BLMC-142	143.0 [5.63]	5	8
BLMC-192	193.0 [7.60]	7	12
BLMC-267	268.0 [10.55]	8	20

\*Add 9.5 [0.38] To Forcer Length "D" For Optional Cooling

Figure 1-4: BLM Model Dimensions

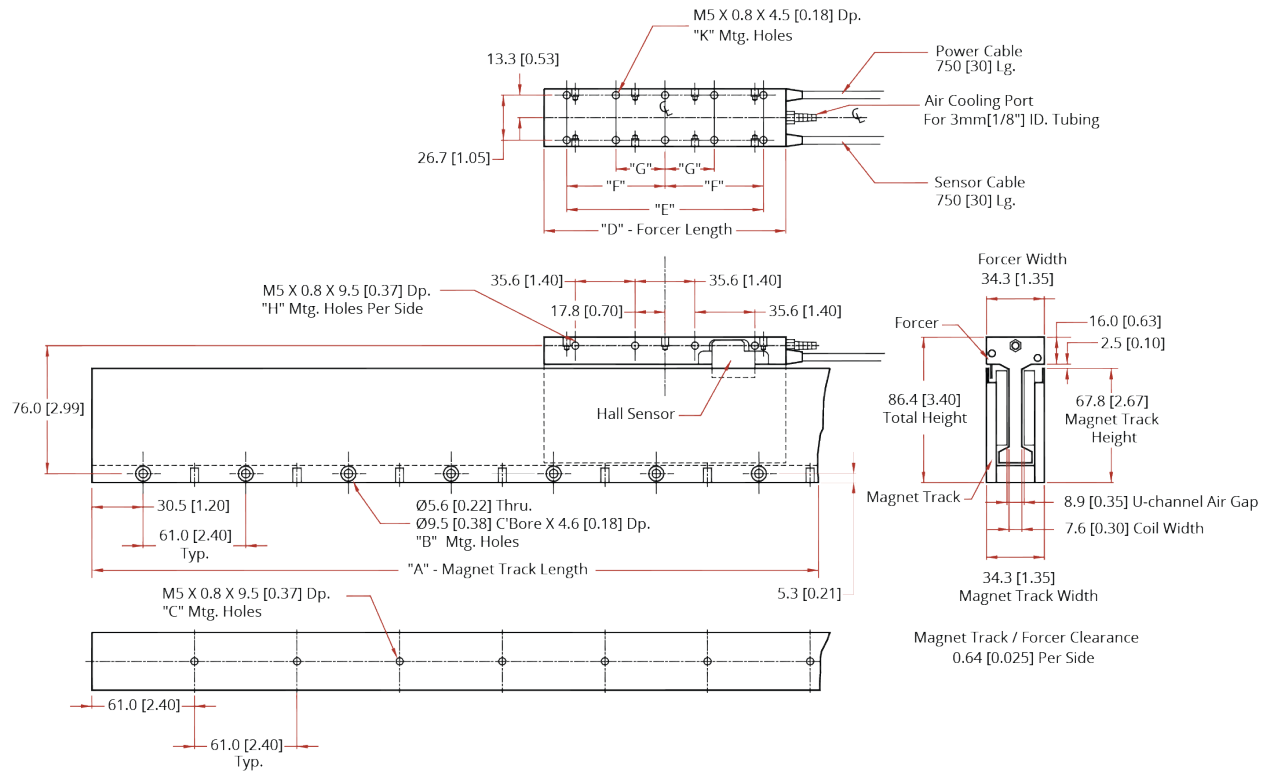

Magnet Track


Model No.	A	B	C
MT240	243.8 [9.6]	4	3
MT300	304.8 [12.0]	5	4
MT360	365.8 [14.4]	6	5
MT420	426.7 [16.8]	7	6
MT480	487.7 [19.2]	8	7
MT600	609.6 [24.0]	10	9

Dimensions - millimeters [inches]

Forcer

Model No.	D	E	F	G	H	K
BLM-142	143.8 [5.66]	116.8 [4.60]	58.4 [2.30]	NA	4	6
BLM-203	204.7 [8.06]	177.8 [7.00]	88.9 [3.50]	NA	4	6
BLM-264	265.7 [10.46]	238.8 [9.40]	119.4 [4.70]	NA	6	6
BLM-325	326.6 [12.86]	299.7 [11.80]	149.9 [5.90]	82.7 [3.26]	8	10
BLM-386	387.6 [15.26]	360.6 [14.20]	180.3 [7.10]	96.5 [3.80]	9	10

Figure 1-5: BLMH Model Dimensions

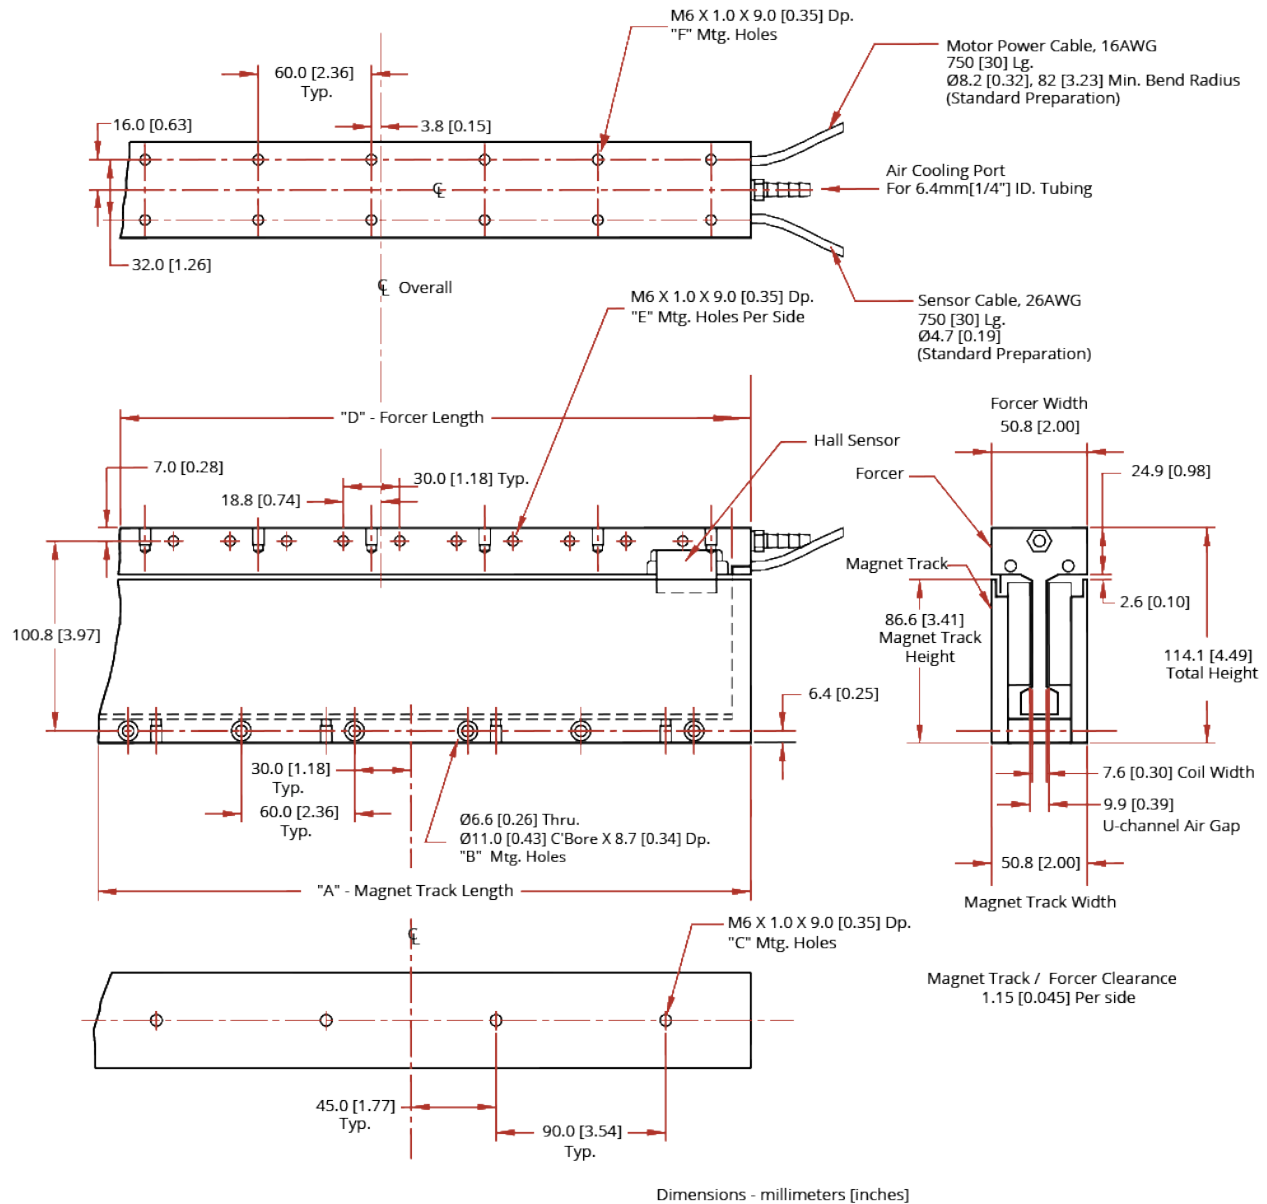


Magnet Track

Model No.	A	B	C
MTH240	240.0 [9.45]		2
MTH300	300.0 [11.81]		4
MTH360	360.0 [14.17]		4
MTH480	480.0 [18.90]	8	4
MTH600	600.0 [23.63]	10	6
MTH720	720.0 [28.35]	12	8

Forcer

Model No.	D	E	F
BLMH-142	154.5 [6.08]	4	6
BLMH-262	274.5 [10.81]	8	10
BLMH-382	394.5 [15.53]	12	14

Figure 1-6: BLMX Model Dimensions

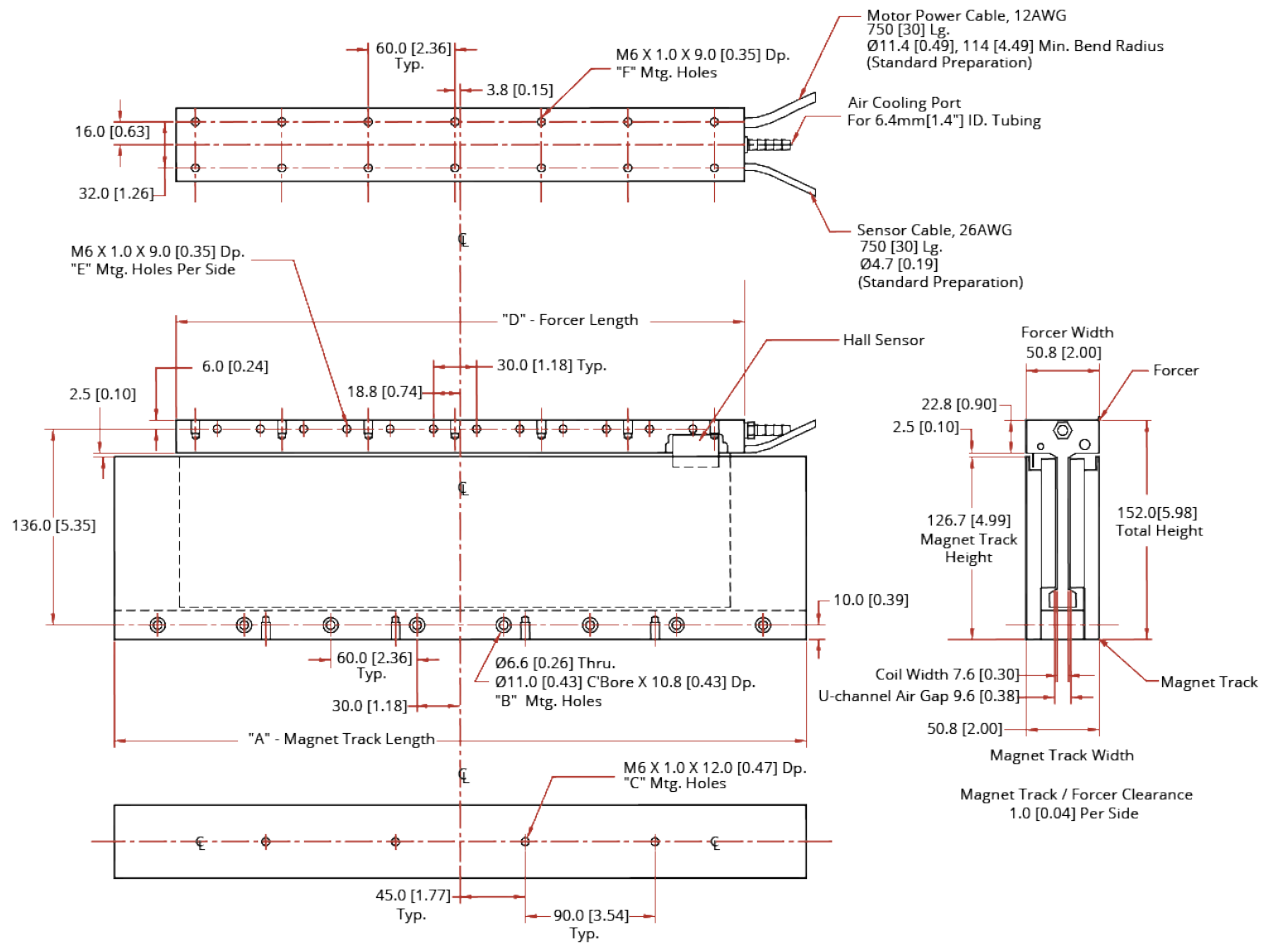

Magnet Track

Model No.	A	B	C
MTX480	480.0 [18.90]	8	4
MTX600	600.0 [23.63]	10	6
MTX720	720.0 [28.35]	12	8

Dimensions - millimeters [inches]

Forcer

Model No.	D	E	F
BLMX-382	394.5 [15.53]	12	14
BLMX-502	514.5 [20.26]	16	18

### 1.3. Environmental Specifications



**WARNING:** Use this product only in environments and operating conditions that are approved in this manual.

**Table 1-18: Environmental Specifications**

<b>Ambient Temperature</b>	Operating: 0 °C to 25 °C (32 °F to 77 °F) Contact Aerotech for information regarding your specific application and environment.
	Storage: -10 °C to 85 °C (14 °F to 185 °F) in original shipping packaging
<b>Humidity</b>	Operating: 20% to 60% RH
	Storage: 10% to 70% RH, non-condensing in original packaging.
	Ambient conditions need to be such that condensation on the motor does not occur. The motors are not to be used in wash-down environments.
<b>Altitude</b>	Operating: 0 m to 1,000 m (0 ft to 3,280 ft) above sea level
	Contact Aerotech if your specific application involves use above 1,000 m or below sea level.
<b>Atmosphere</b>	Not to be used in a hydrogen atmosphere.
<b>Use</b>	Indoor use only



## 1.4. Air Requirements

For the motor to operate correctly, the air supply must meet Aerotech specifications.

Air supplied to the motor should be clean and liquid water should not be present.

- If compressed air is used, it must be filtered to 0.25 microns, dry to 0 ° F dew point, and oil free.
- If nitrogen is used, it must be 99.99% pure and filtered to 0.25 microns.

If the air is unfiltered, particles will clog the internal components of the motor.

## 1.5. Vacuum Operation

There are two vacuum preparation options:

- Low Vacuum (for use in environments from atmospheric pressure, down to  $10^{-3}$  Torr)
- High Vacuum (for use in environments from  $10^{-3}$  Torr, down to  $10^{-6}$  Torr)

Special preparations include:

- Parts are lubricated with vacuum-compatible lubricants.
- Materials, fasteners, and coatings are selected to be compatible with the specified level of vacuum.
- High-vacuum systems are designed to eliminate trapped volumes.
- Prior to assembly, motor parts are thoroughly cleaned in a clean environment.
- The motor is packaged in a special polyethylene bag.

### Vacuum Guidelines

To ensure that the motor will continue to perform well in the vacuum environment, use the guidelines that follow (in addition to standard handling, installation, and lubrication guidelines outlined in this manual).

1. Do not remove the motor from its sealed bag until it is ready to use.
2. Always handle the motor in a clean environment and use powder-free polyethylene gloves to prevent any contaminants from adhering to the surface of the motor.
3. During installation, use cleaned, vented, stainless steel fasteners to secure the motor.
4. Reduced air pressure eliminates significant convective heat transfer. This, coupled with the viscous vacuum-compatible lubricants, could result in excessive motor operating temperatures. Because of this, consider all continuous torque ratings to be **40 to 60% lower** than the value specified for operation in normal atmospheric environment. Reduce motor usage accordingly.
5. We recommend that you use a small quantity of **Braycote® 602EF** grease or a compatible substitute of equal quality lubricant in vacuum applications.
6. To reduce outgassing during the initial pump-down to vacuum pressure, Aerotech recommends that you bake out vacuum systems when you first install them into the vacuum chamber. Bake the vacuum components at 60 °C for 24 to 48 hours to desorb water vapor from surfaces and degas polymers (such as cable insulation).

## Chapter 2: Assembly and Installation




**WARNING:** To prevent injury or damage to the equipment, you will need devices in place that will prevent unexpected motion in the event of an intentional or unintentional disruption of electrical power. Applications with vertical axes require a fail-safe brake.

A linear motor consists of two main components, a forcer and a magnet track. Interaction between the forcer and magnet track produces a force to cause linear motion. The controller, amplifier, and position feedback devices provide for the correct commutation and position of the motor.

The linear motor can be configured in two different ways. The magnet track can be held stationary while the forcer moves or the forcer can be held stationary while the magnet track moves.

**Figure 2-1: Motor Assembled in a Linear Stage**

The stage tabletop and hardcover have been removed.

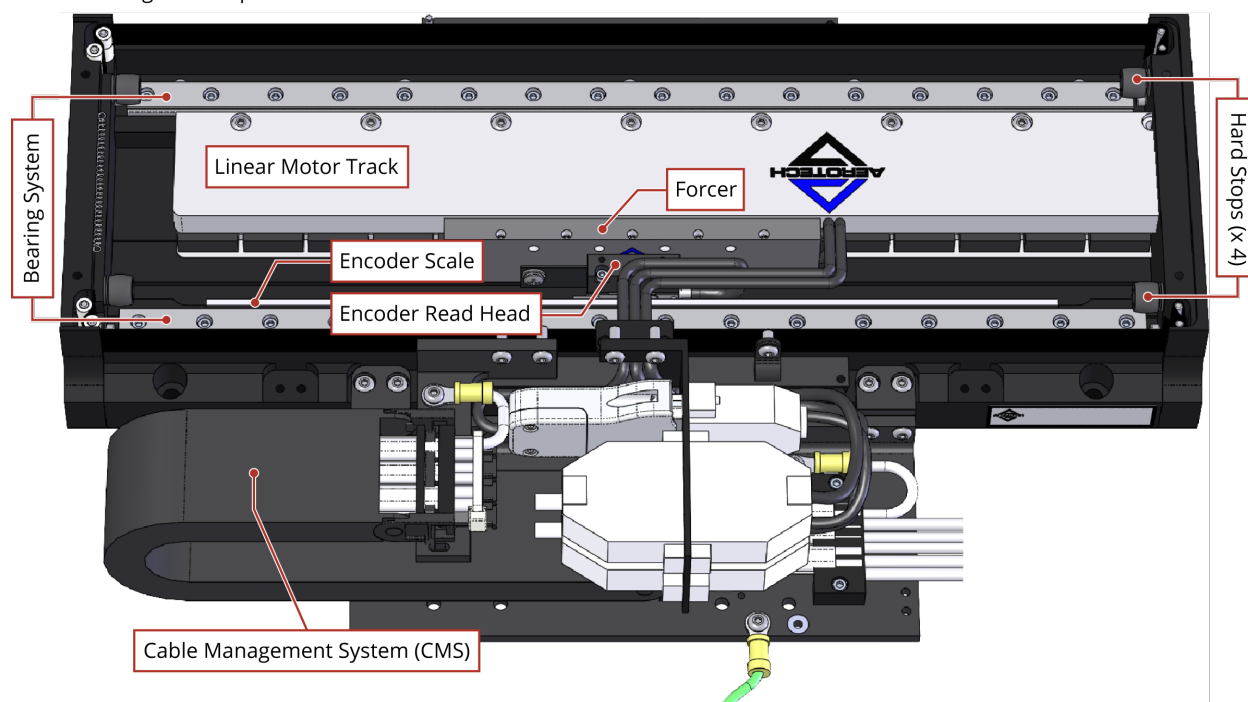

## 2.1. Bearing System

Like a ball screw carriage, the linear forcer assembly must be supported by a linear bearing system (refer to [Figure 2-1](#)). The linear bearing system must be capable of supporting the load/heat sink and the forcer. The forcer is constructed of non-magnetic materials, and, consequently, the forcer is not attracted to the magnet track.

## 2.2. Position Transducer Resolution

The motion controller requires a position transducer for all forms of motion control. This is typically a linear encoder. The specific application determines the encoder resolution.

## 2.3. Cable Management

If the forcer moves in the system, you must use a high-flex cable management system (CMS). If the stage moves and the forcer is stationary, you do not need to use a CMS.

If the forcer motor power and feedback cables are long enough for your travel, they can be used in the CMS.

If the forcer motor power and feedback cables are not long enough for the CMS or if this is a vacuum-prepared system, the cables will need to terminate before they enter the CMS. You will need to terminate the flying leads of the forcer cables at, in most cases, standard D-shell connectors. You should then connect those connectors to the mating connectors of the high-flex cables that will be used in the CMS.

Refer to [Table 2-1](#) for required bend radius for a given high flex cable forcer.


**Table 2-1: Bend Radius**

Motor	Bend Radius
BLMSC, BLMUC, BLMC, BLM	47 mm [1.9 in]
BLMH	82 mm [3.2 in]
BLMX	114 mm [4.5 in]

## 2.4. Mechanical Arrangement of the Magnet Track

You can mount the magnet track with the opening up, down, left, or right based on the machine design.

**Figure 2-2: Linear Motor Mounting Configurations (end view)**

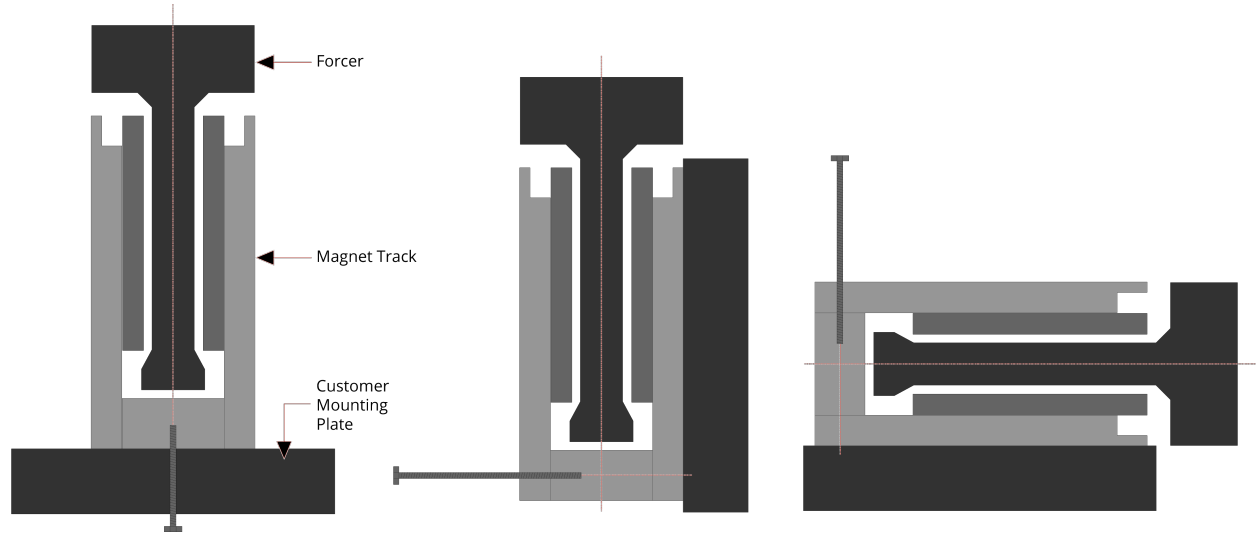


## 2.5. Track Stacking

Connect the magnet tracks end-to-end to increase the linear motor travel distance. Align the labels as shown.



**IMPORTANT:** Use a reference edge or alignment fixture and mounting hole pattern (refer to [Section 1.2. Dimensions](#)) to align the tracks. A small gap (up to 0.5 mm [.020"]) between adjacent tracks will not adversely effect forcer performance.

**Figure 2-3: Stacking Tracks**

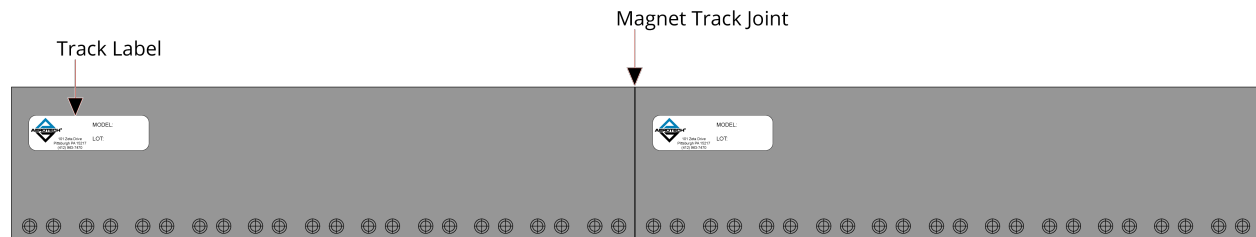

## 2.6. Straightness and Flatness Tolerance

In order for the linear motor system (forcer and magnet track) to operate correctly, it must be properly aligned to the bearing system travel. This section outlines the maximum permissible deviation the motor can see during motion and still operate properly.


The straightness and flatness tolerances are the deviations from a straight line in two dimensions during travel. There are two separate alignment tolerances: straightness (side-to-side) and flatness (in-and-out).

### 2.6.1. BLMSC Tolerances

With the forcer aligned as in [Figure 2-4](#), the air gap in the magnet track is 0.76 mm (0.030 in) on either side of the forcer. The straightness can deviate left or right  $\pm 0.38$  mm (0.015 in) from the centerline. For example, a deviation can result in an 0.38 mm (0.015 in) air gap on one side and 1.14 mm (0.045 in) on the other side.

The nominal forcer height out of the track is 1.3 mm (0.051 in). The flatness can deviate up an additional 0.25 mm (0.010 in) for a total of 2.26 mm (0.089 in) from the track edge to the forcer edge. The flatness can also deviate down 0.25 mm (0.010 in) for a total of 1.75 mm (0.069 in) from the track edge to the forcer edge.

**Figure 2-4: BLMSC Straightness and Flatness Tolerances**

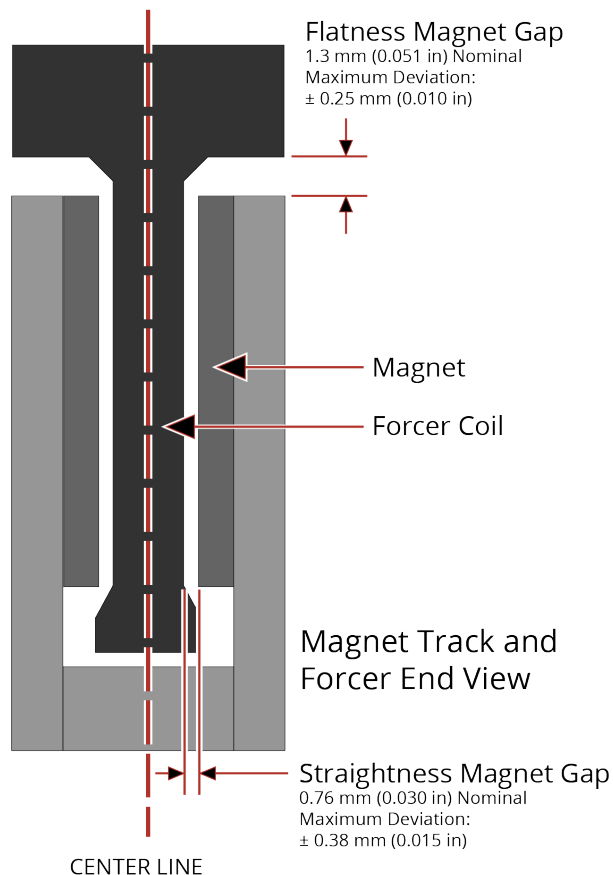


### 2.6.2. BLMUC Tolerances

With the forcer aligned as in [Figure 2-5](#), the air gap in the magnet track is 0.76 mm (0.030 in) on either side of the forcer. The straightness can deviate left or right  $\pm 0.38$  mm (0.015 in) from the centerline. For example, a deviation can result in an 0.38 mm (0.015 in) air gap on one side and 1.14 mm (0.045 in) on the other side.

The nominal forcer height out of the track is 2.0 mm (0.079 in). The flatness can deviate up an additional 0.25 mm (0.010 in) for a total of 2.26 mm (0.089 in) from the track edge to the forcer edge. The flatness can also deviate down 0.25 mm (0.010 in) for a total of 1.75 mm (0.069 in) from the track edge to the forcer edge.

**Figure 2-5: BLMUC Straightness and Flatness Tolerances**

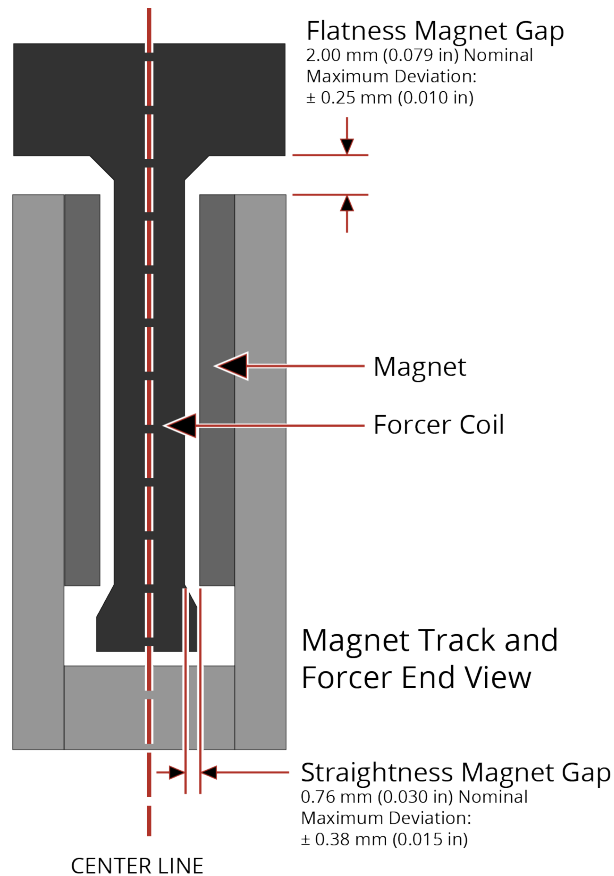


### 2.6.3. BLMC Tolerances

With the forcer aligned as in [Figure 2-6](#), the air gap in the magnet track is 0.76 mm (0.030 in) on either side of the forcer. The straightness can deviate left or right  $\pm 0.38$  mm (0.015 in) from the centerline. For example, a deviation can result in an 0.38 mm (0.015 in) air gap on one side and 1.14 mm (0.045 in) on the other side.

The nominal forcer height out of the track is 1.3 mm (0.050 in). The flatness can deviate up an additional 0.38 mm (0.015 in) for a total of 1.65 mm (0.065 in) from the track edge to the forcer edge. The flatness can also deviate down 0.38 mm (0.015 in) for a total of 0.89 mm (0.035 in) from the track edge to the forcer edge.

**Figure 2-6: BLMC Straightness and Flatness Tolerances**

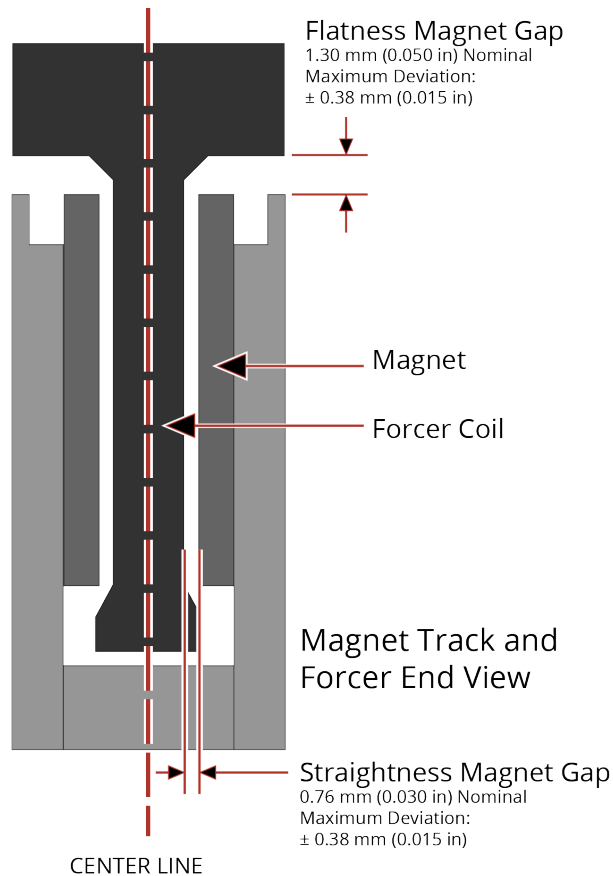




### 2.6.4. BLM Tolerances

With the forcer aligned as in [Figure 2-7](#), the air gap in the magnet track is 0.025 in (0.64 mm) on either side of the forcer. The straightness can deviate left or right  $\pm 0.25$  mm (0.010 in) from the centerline. For example, a deviation can result in an 0.38 mm (0.015 in) air gap on one side and 0.89 mm (0.035 in) on the other side.

The nominal forcer height out of the track is 2.5 mm (0.10 in). The flatness can deviate up an additional 0.51 mm (0.020 in) for a total of 3.05 mm (0.120 in) from the track edge to the forcer edge. The flatness can also deviate down 0.51 mm (0.020 in) for a total of 2.0 mm (0.080 in) from the track edge to the forcer edge.

**Figure 2-7: BLM Straightness and Flatness Tolerances**

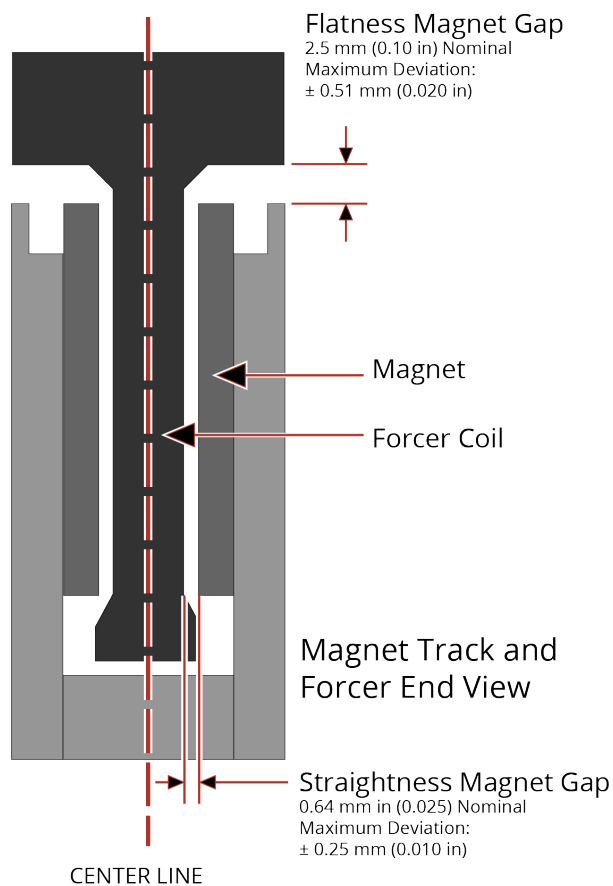


### 2.6.5. BLMH Tolerances

With the forcer aligned as in [Figure 2-8](#), the air gap in the magnet track is 1.1 mm (0.045 in) on either side of the forcer. The straightness can deviate left or right to  $\pm 0.64$  mm (0.025 in) from the centerline. For example, a deviation can result in an 0.51 mm (0.020 in) air gap on one side and 1.79 mm (0.070 in) on the other side.

The nominal forcer height out of the track is 2.5 mm (0.10 in). The flatness can deviate up an additional 0.51 mm (0.020 in) for a total of 3.1 mm (0.120 in) from the track edge to the forcer edge. The flatness can also deviate down 0.020 in (0.51 mm) for a total of 2.0 mm (0.080 in) from the track edge to the forcer edge.

**Figure 2-8: BLMH Straightness and Flatness Tolerances**

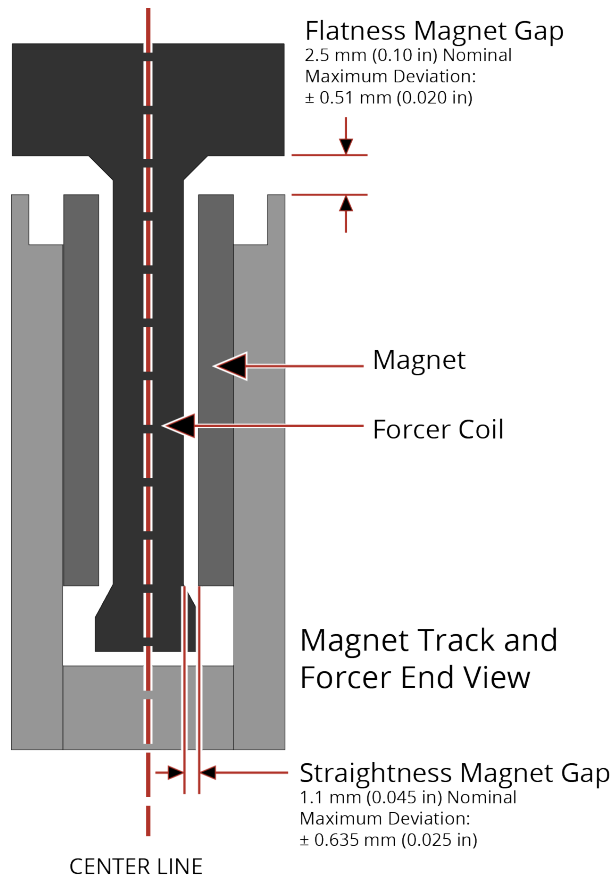


### 2.6.6. BLMX Tolerances

With the forcer aligned as in [Figure 2-9](#), the air gap in the magnet track is 1.0 mm (0.040 in) on either side of the forcer coil. The straightness can deviate left or right to  $\pm 0.51$  mm (0.020 in) from the centerline. For example, a deviation can result in an 0.51 mm (0.020 in) air gap on one side and 1.52 mm (0.060 in) on the other side.

The nominal forcer height out of the track is 2.5 mm (0.10 in). The flatness can deviate up an additional 0.38 mm (0.015 in) for a total of 2.92 mm (0.115 in) from the track edge to the forcer coil. The flatness can also deviate down 0.38 mm (0.015 in) for a total of 2.2 mm (0.085 in) from the track edge to the forcer edge.

**Figure 2-9: BLMX Straightness and Flatness Tolerances**

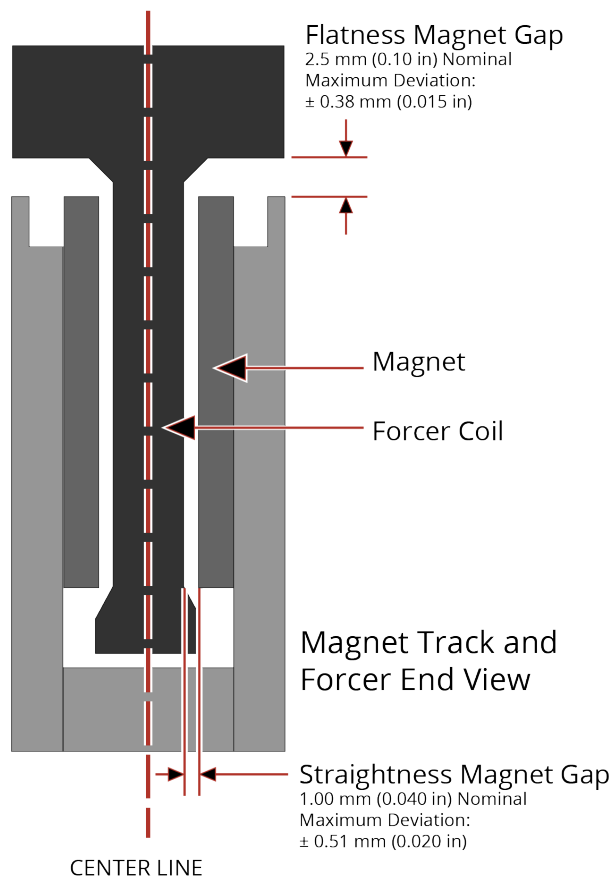


## 2.7. External Motor Wiring

The forcer is supplied with flying leads for the motor winding, Hall-effect devices, and thermal overload sensor. It is the responsibility of the customer to supply all external wiring to interface with these devices. Customer-supplied wiring must obey all local electrical safety requirements.

- The wiring must be able to supply the rated current without overheating.
- The wire insulation must be rated for the voltage and temperature at which the motor is operating.
- Cable selection and installation should be made to reduce EMI emissions and to increase EMI immunity.

In addition to the external wiring, it is also the responsibility of the customer to provide over-current protection for the motor.

**Figure 2-10: Motor Wiring with Flying Leads**

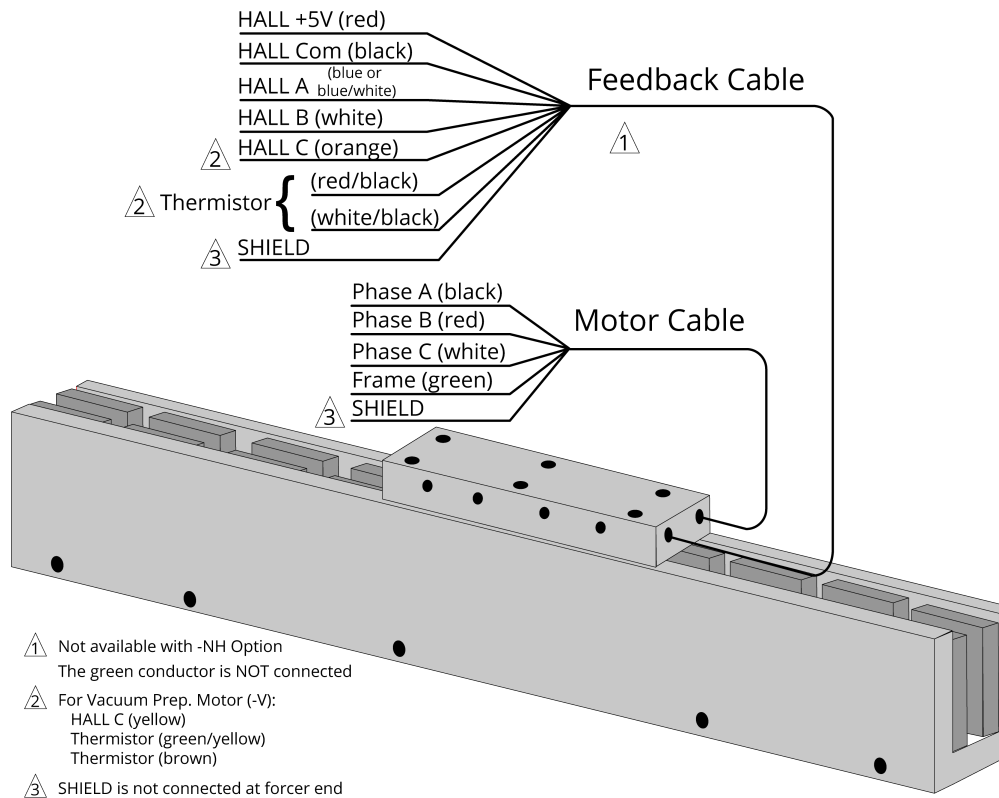

**Table 2-2: Cable Diameter and Wire Gauge**

Motor (Standard Preparation)	Motor		Feedback	
	Cable Diameter mm (in)	Wire Gauge AWG (mm <sup>2</sup> )	Cable Diameter mm (in)	Wire Gauge AWG (mm <sup>2</sup> )
BLMSC, BLMUC, BLMC, BLM	4.7 (0.19)	22 (0.33)	4.7 (0.19)	26 (0.13)
BLMH	8.2 (0.32)	16 (1.31)	4.7 (0.19)	26 (0.13)
BLMX	11.4 (0.49)	12 (3.31)	4.7 (0.19)	26 (0.13)

### 2.7.1. Motor Power Conductors

The motor power conductors must be sized to handle the electrical current requirements of the motor (refer to [Section 1.1. Motor Specifications](#)). Select the wire insulation voltage rating based on the maximum voltage that will be applied to the motor.

### 2.7.2. Protective Ground

The protective ground is a safety conductor that you must use to ground the motor case. The protective ground conductor must have a current carrying capacity at least equal to the carrying capacity of the motor wires. The standard insulation is "Green/Yellow" and must be rated for the maximum voltage applied to the motor winding. The protective ground wire is typically bundled with the motor wires, but your system could require a separate protective ground wire.

### 2.7.3. Over-Current Protection

You will need to provide the motor with over-current protection to prevent the motor from overheating. Use programmable current limits, traps, over-current protection circuitry, or fuses. Fuse values should be selected according to the RMS current rating of the motor. For most applications, you should use slow-blow type fuses.

When the motor is part of an Aerotech system that uses an Aerotech controller and drive, use the "A<sub>pk</sub>" continuous current rating to set the motor over-current protection fault (refer to [Section 1.1.](#)). If the motor is not installed in a system configured by Aerotech, you must provide the over-current protection.

#### **2.7.4. Hall-Effect Device and Thermistor Wiring**

The insulation of these wires should have a rating for at least the maximum voltage applied to the motor winding. The temperature rating of the wire insulation must also be sufficiently high to withstand the operating temperatures specific to the application.

#### **2.7.5. Wiring Guidelines**

The wiring guidelines given below can help to reduce EMI related problems which can result in poor overall system performance.

- Keep cable lengths as short as possible. Long cable runs are more susceptible to EMI pickup than short runs.
- Use grounded shielded cables for both the motor power and signal wiring.
- Use twisted pair shielded cabling to help reduce magnetically induced currents.
- Braided shield has a slightly better low frequency shielding capability than a foil shield. Foil is often used where RF shielding is necessary.
- Do not bundle signal, motor power cables, or AC power lines within the same protective shield or conduit. Use separate protective shields or conduits.
- Do not introduce multiple paths to ground from a grounding point. Multiple paths to ground can create ground loops within the system.
- If necessary, use an EMI suppression device.


### 2.7.6. Thermal Protective Device

BLM motors use a positive-temperature coefficient (PTC) thermistor as a thermal protection device. The nominal resistance of the thermistor is 100 ohms at 25 °C. The resistance of the thermistor will increase rapidly to 1,000 ohms as the motor temperature increases to the 100 °C transition temperature of the thermistor. The transition temperature is 90 °C for the BLMX motor.



**WARNING:** The thermal protective device used in the motor must be connected to an external shutdown circuit to provide protection to the motor.


**Figure 2-11: Thermal Sensor Resistance as a Function of Temperature**

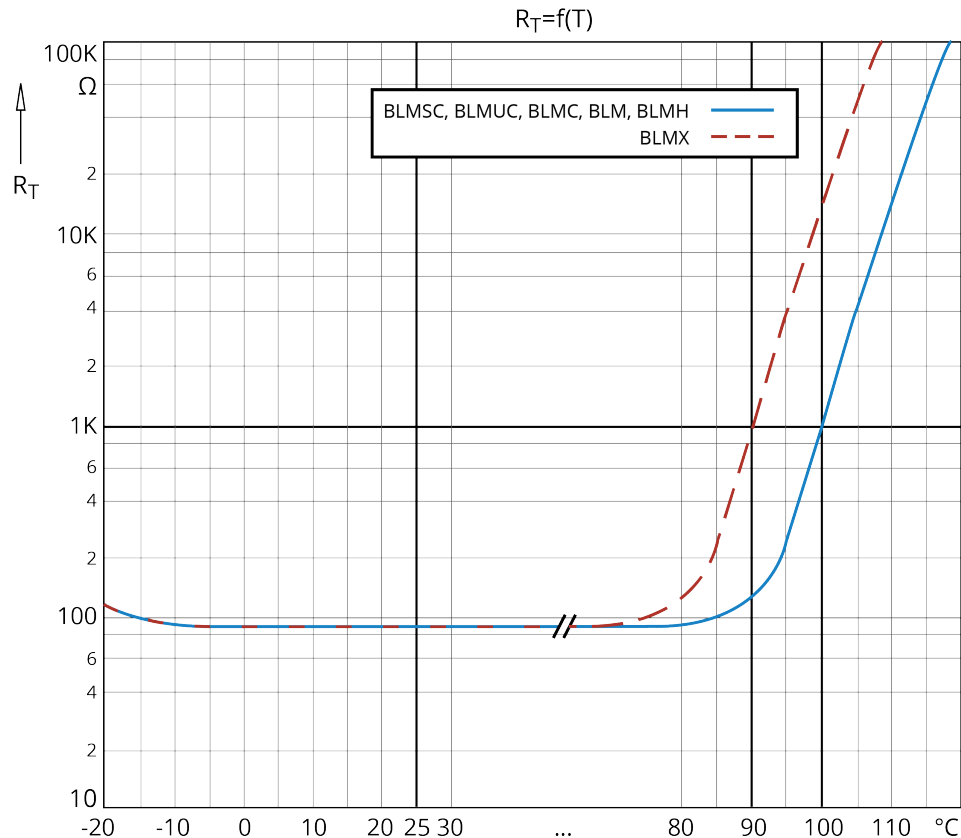



**WARNING:** If you connect the thermistor to the interface circuit incorrectly, you could cause the thermistor to self-heat. If too much current passes through the thermistor, the temperature will increase and cause the thermistor to activate and increase resistance.

**Figure 2-12: Typical Thermistor Interface Circuit**

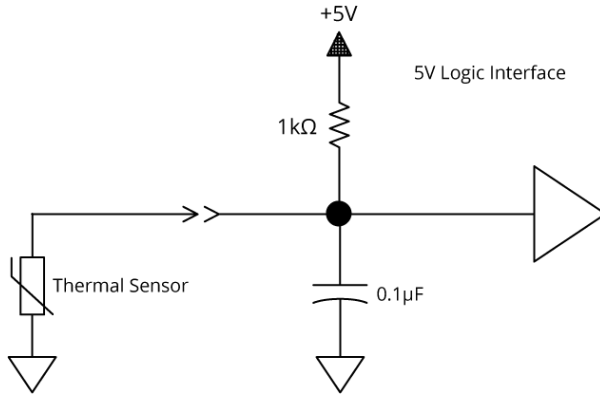




## 2.8. Hall-Effect Operation and Motor Phasing

In linear servomotors, one popular method of commutation is with Hall-effect sensors. They sense the presence of a magnetic field and provide an output as a function of the forcer position. Aerotech linear motor Hall sensors provide a unique set of Hall-sensor outputs every 60 electrical degrees. Therefore the forcer position can be resolved to any of six segments over 360 electrical degrees. The Hall sensors used in the linear motors have an open collector output. Figure 2-13 shows the motor BEMF versus Hall signal relationship for positive motion.

**Figure 2-13: Linear Motor Phasing**

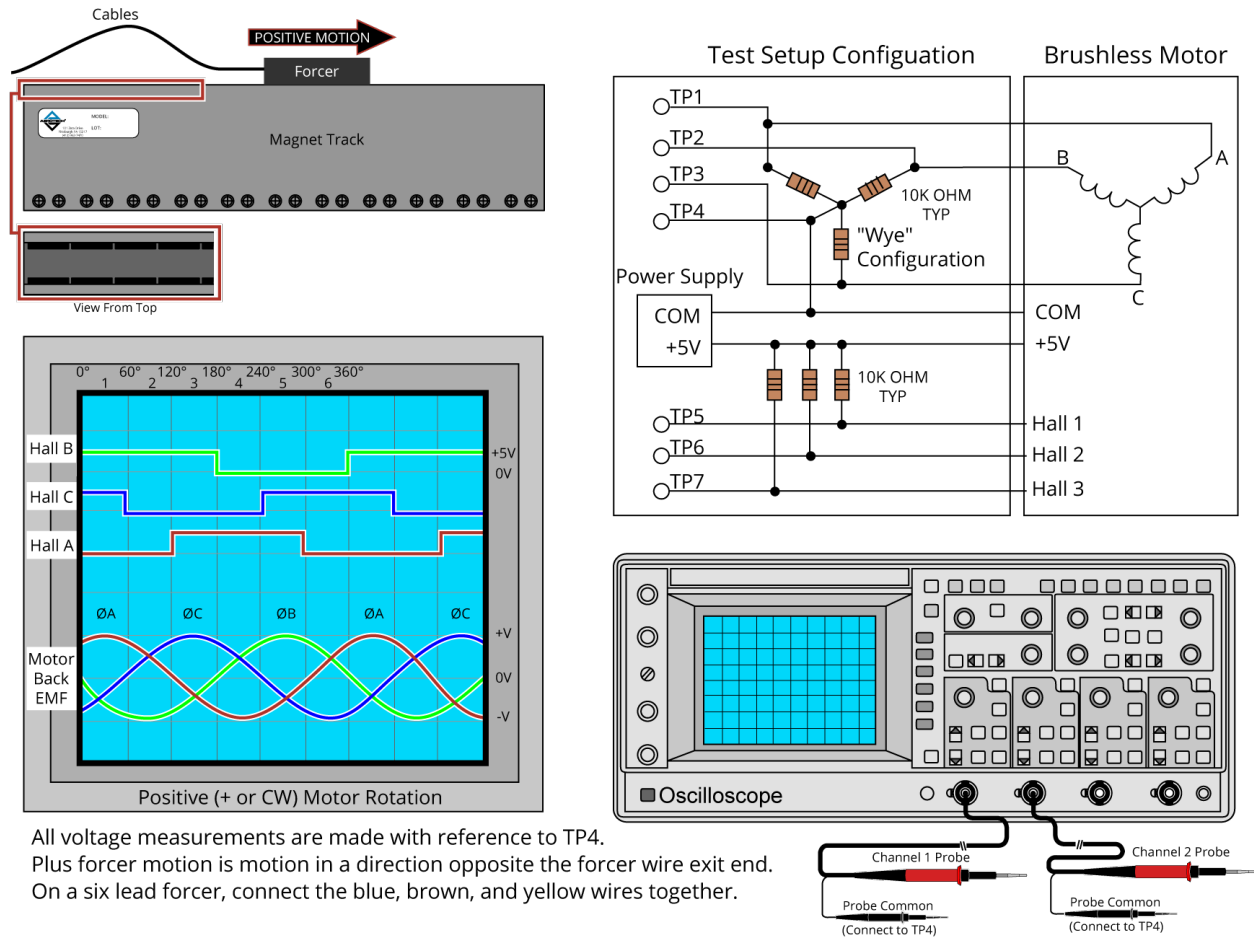

All voltage measurements are made with reference to TP4.  
 Plus forcer motion is motion in a direction opposite the forcer wire exit end.  
 On a six lead forcer, connect the blue, brown, and yellow wires together.

## 2.9. Motor Heating

The amount of current that can pass through the motor winding is limited by a rise in temperature above ambient. If the temperature of the motor exceeds the thermal limit, the thermistor sensor will send a signal to the controller and the controller will stop the motor.

The motor specifications show the continuous motor current that will result in a predetermined temperature rise of the motor. The motor specifications listed in [Section 1.1](#) were compiled under a single set of operating conditions and environmental specifications ([Section 1.3](#)).

The operating conditions of the motor are defined by:

- The thermal characteristics of the motor.
- The effectiveness of the medium that surrounds the motor to transfer heat away from the motor.
- The use of supplemental cooling.

Examples of what could cause the motor to overheat:

- Poor heat transfer away from the motor.
- The load is too high for the motor.
- The ambient temperature has increased above the expected operating conditions.

## Chapter 3: Maintenance



**DANGER:** To minimize the possibility of bodily injury or death, disconnect all electrical power before you do maintenance or make adjustments to the equipment.



**DANGER: Strong Magnets / Electromagnetic Fields**

- Interaction with metallic objects could produce pinch dangers.
- Use non-magnetic tools when you do service to the motor.
- Do not attempt to disassemble the magnet track.

Inspect the BLM motor at least once per month. You will have to determine a longer or shorter inspection interval based on the application and conditions, such as the duty cycle, speed, and environment.

Visually inspect the motor and cables to make sure that:

- the motor does not become too hot.
- the motor does not vibrate too much.
- the air flow to the motor is not blocked.
- you do not see evidence of burns or smell smoke.

You will also need to

- tighten loose motor-to-machine hardware.
- remove an accumulation of debris on the motor.
- replace or repair damaged cables.
- clean the motor and any components and cables if needed.
- assess any damage to the motor.

### Cleaning

Motors should be wiped with a clean dry cloth to remove any grease, dirt, or other material that has accumulated on the motor. Do not use fluids and sprays so that you do not contaminate the internal parts of the motor. Be careful when you clean the motor so that you do not remove the text on the motor labels.

### Lubrication

Aerotech U-Channel linear motors do not require lubrication. It is the responsibility of the customer or OEM to lubricate customer-supplied components.

### Repairs

In general, it is not possible for field service personnel to repair and/or replace damaged or components that have malfunctioned. Repair typically requires that you return the unit to the factory.

Contact Aerotech Global Technical Support for more information.

*This page intentionally left blank.*

## Appendix A: Warranty and Field Service

Aerotech, Inc. warrants its products to be free from harmful defects caused by faulty materials or poor workmanship for a minimum period of one year from date of shipment from Aerotech. Aerotech's liability is limited to replacing, repairing or issuing credit, at its option, for any products that are returned by the original purchaser during the warranty period. Aerotech makes no warranty that its products are fit for the use or purpose to which they may be put by the buyer, whether or not such use or purpose has been disclosed to Aerotech in specifications or drawings previously or subsequently provided, or whether or not Aerotech's products are specifically designed and/or manufactured for buyer's use or purpose. Aerotech's liability on any claim for loss or damage arising out of the sale, resale, or use of any of its products shall in no event exceed the selling price of the unit.

THE EXPRESS WARRANTY SET FORTH HEREIN IS IN LIEU OF AND EXCLUDES ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, BY OPERATION OF LAW OR OTHERWISE. IN NO EVENT SHALL AEROTECH BE LIABLE FOR CONSEQUENTIAL OR SPECIAL DAMAGES.

### Return Products Procedure

Claims for shipment damage (evident or concealed) must be filed with the carrier by the buyer. Aerotech must be notified within thirty (30) days of shipment of incorrect material. No product may be returned, whether in warranty or out of warranty, without first obtaining approval from Aerotech. No credit will be given nor repairs made for products returned without such approval. A "Return Materials Authorization (RMA)" number must accompany any returned product(s). The RMA number may be obtained by calling an Aerotech service center or by submitting the appropriate request available on our website ([www.aerotech.com](http://www.aerotech.com)). Products must be returned, prepaid, to an Aerotech service center (no C.O.D. or Collect Freight accepted). The status of any product returned later than thirty (30) days after the issuance of a return authorization number will be subject to review.

Visit [Global Technical Support Portal](#) for the location of your nearest Aerotech Service center.

### Returned Product Warranty Determination

After Aerotech's examination, warranty or out-of-warranty status will be determined. If upon Aerotech's examination a warranted defect exists, then the product(s) will be repaired at no charge and shipped, prepaid, back to the buyer. If the buyer desires an expedited method of return, the product(s) will be shipped collect. Warranty repairs do not extend the original warranty period.

**Fixed Fee Repairs** - Products having fixed-fee pricing will require a valid purchase order or credit card particulars before any service work can begin.

**All Other Repairs** - After Aerotech's evaluation, the buyer shall be notified of the repair cost. At such time the buyer must issue a valid purchase order to cover the cost of the repair and freight, or authorize the product(s) to be shipped back as is, at the buyer's expense. Failure to obtain a purchase order number or approval within thirty (30) days of notification will result in the product(s) being returned as is, at the buyer's expense.

Repair work is warranted for ninety (90) days from date of shipment. Replacement components are warranted for one year from date of shipment.

### Rush Service

At times, the buyer may desire to expedite a repair. Regardless of warranty or out-of-warranty status, the buyer must issue a valid purchase order to cover the added rush service cost. Rush service is subject to Aerotech's approval.

### On-site Warranty Repair

If an Aerotech product cannot be made functional by telephone assistance or by sending and having the customer install replacement parts, and cannot be returned to the Aerotech service center for repair, and if Aerotech determines the problem could be warranty-related, then the following policy applies:

Aerotech will provide an on-site Field Service Representative in a reasonable amount of time, provided that the customer issues a valid purchase order to Aerotech covering all transportation and subsistence costs. For warranty field repairs, the customer will not be charged for the cost of labor and material. If service is rendered at times other than normal work periods, then special rates apply.

If during the on-site repair it is determined the problem is not warranty related, then the terms and conditions stated in the following "On-Site Non-Warranty Repair" section apply.

### On-site Non-Warranty Repair

If any Aerotech product cannot be made functional by telephone assistance or purchased replacement parts, and cannot be returned to the Aerotech service center for repair, then the following field service policy applies:

Aerotech will provide an on-site Field Service Representative in a reasonable amount of time, provided that the customer issues a valid purchase order to Aerotech covering all transportation and subsistence costs and the prevailing labor cost, including travel time, necessary to complete the repair.

### Service Locations

<https://www.aerotech.com/contact-sales.aspx?mapState=showMap>

#### **USA, CANADA, MEXICO**

Aerotech, Inc.  
Global Headquarters

#### **CHINA**

Aerotech China  
Full-Service Subsidiary

#### **GERMANY**

Aerotech Germany  
Full-Service Subsidiary

#### **TAIWAN**

Aerotech Taiwan  
Full-Service Subsidiary

#### **UNITED KINGDOM**

Aerotech United Kingdom  
Full-Service Subsidiary

## Appendix B: Revision History

Revision	Description
3.00	<ul style="list-style-type: none"> <li>• EU Declaration of Conformity updated.</li> <li>• UK Declaration of Conformity added.</li> <li>• Safety Procedures and Warnings updated.</li> <li>• Ordering options updated</li> <li>• Specifications updated</li> <li>• Dimensions updated</li> </ul>
2.08	Revision changes have been archived. If you need a copy of this revision, contact AerotechGlobal Technical Support.
2.07	
2.06	
2.05	
2.04	
2.03	
2.02	
2.01	
2.00	
1.08	
1.07	
1.06	
1.05	
1.04	
1.03a	
1.02	
1.02	
1.01a	

*This page intentionally left blank.*



# Index

		Motor Specifications	23
		Vacuum Options	17
	<b>2</b>	BLMUC	
		Cooling Options	18
		Dimensions	35
		Forcer Options	18
		Hall Options	18
		Vacuum Options	18
		Winding Options	18
		BLMX	
		Cooling Options	22
		Dimensions	39
		Forcer Options	22
		Hall Options	22
		Motor Specifications	33
		Vacuum Options	22
		Winding Options	22
		BLUMC	
		Motor Specifications (P Magnet Track)	24
		Motor Specifications (S Magnet Track)	25
		Braycote® 602EF	42
		<b>C</b>	
		clean	59
		<b>D</b>	
		Declaration of Conformity	7-8
		<b>E</b>	
		Electrical Warnings	11
		Encoder Scale example	43
		EU 2015/863	7
		<b>F</b>	
		Flying Leads	52
		<b>G</b>	
		grease	42
		<b>H</b>	
		Handling	15
		Humidity	40
		2014/35/EU	7
	<b>A</b>		
Altitude			40
Ambient Temperature			40
Atmosphere			40
	<b>B</b>		
Bend Radius			44
BLM			
Cooling Options			20
Dimensions			37
Forcer Options			20
Hall Options			20
Motor Specifications (P Magnet Track)			28-29
Motor Specifications (S Magnet Track)			30-31
Vacuum Options			20
Winding Options			20
BLMC			
Cooling Options			19
Dimensions			36
Forcer Options			19
Hall Options			19
Motor Specifications (P Magnet Track)			26
Motor Specifications (S Magnet Track)			27
Vacuum Options			19
Winding Options			19
BLMH			
Cooling Options			21
Dimensions			38
Forcer Options			21
Hall Options			21
Motor Specifications (P Magnet Track)			32
Vacuum Options			21
Winding Options			21
BLMSC			
Cooling Options			17
Dimensions			34
Forcer Options			17
Hall Options			17

<b>I</b>		<b>W</b>	
Indoor use only	40	Warnings	9
		Warranty and Field Service	61
		Wiring Guidelines	54
<b>L</b>			
label	15		
Linear Motor Mounting Configurations	45		
lubricant			
vacuum	42		
<b>M</b>			
Motor-Related Warnings	12		
Motor Power Conductors	53		
Motor Specifications	23		
<b>P</b>			
packing list	15		
part number	15		
Protective Ground	53		
<b>R</b>			
repair	59		
Revision History	63		
<b>S</b>			
serial number	15		
Specifications	23		
stabilizing stage	16		
Stacking Tracks	45		
stage			
stabilizing	16		
Storage	15		
<b>T</b>			
Table of Contents	3		
Thermal Protective Device	55		
Thermistor Interface Circuit	56		
transducer	44		
<b>V</b>			
vacuum guidelines	42		
vacuum lubricant (Braycote 602EF)	42		